

1605 Quail Ln INSPECTION REPORT (LBHI #10827)

Prepared For Exclusive Use By
Heather Shaw



For The Property Located At
1605 Quail Ln, Ruston, LA 71270

NOTICE: This report is provided for the specific benefit of the client named above and is based on observations at the time of the inspection. If you did not hire the inspector yourself, reliance on this report may provide incomplete or outdated information. Repairs, professional opinions or additional inspection reports may affect the meaning of the information in this report. It is recommended that you hire a qualified inspector to perform an inspection to meet your specific needs and to provide you with current information concerning this property.

Table of Contents

General Information	4
Summary Inspection Report	5
1605 Quail Ln INSPECTION REPORT (LBHI #10827)	17
Exterior	17
Grading and Drainage	17
Hardscaping	17
Site Features	22
Building Features	23
Structural	26
Structure & Framing	26
Slab Foundation	27
Garage Foundation	28
Roof	29
Primary Roof	29
Attic and Loft	35
Attic	35
Electrical	36
Service	37
Main Panel	37
Sub Panel	38
Wiring	39
Lights and Switches	40
Receptacle Outlets	40
GFCI Protection	40
Fan Fixtures	40
Plumbing	40
Water Supply System	41
Drainage and Venting System	41
Plumbing Fixtures	41
Water Heater	46
Water Heater #2	49
Gas Supply System	51
Heating	52
Forced Air Furnace	52
Forced Air Furnace #2	54
Heating and Cooling	55
Split System	55
Split System #2	57
Fireplace	59
Masonry	59
Interior	60
General	60
Floors	60
Walls and Ceilings	61
Windows	62
Doors	62
Stairs and Landings	63
Built-In Appliances	63
Laundry Provisions	65
Smoke Alarms	66

Ventilation and Exhaust	67
Other Components	67
Garage	67
Interior	67
Vehicle Doors	67
General	67
Environmental Comments	67
Important Information	68
S.O.P.	70

General Information

Property Address:	1605 Quail Ln
Property City:	Ruston
Property State:	LA
Inspection Date:	10.10.2019
Inspection Start Time:	03:20:00 PM
Inspection End Time:	05:15:00 PM
Inspection Weather:	Sunny and hot
Inspector's Name:	William Byrd
Client's Name:	Heather Shaw
Inspection Fee:	\$300
Structure Type:	Wood Frame
Furnished:	Partially furnished
Number of Stories:	2
Structure Style:	Single Family
Structure Orientation:	South
Property Occupation Status:	Unoccupied

Summary Inspection Report

This summary report is intended to provide the client and those individuals directly involved in this transaction a convenient and cursory preview of some of the conditions and components that we have identified within our report as being in need of further evaluation or service by an appropriately qualified specialist or that pose a potential health and safety risk. It is not intended to be comprehensive, and should not be used as a substitute for reading the entire home inspection report, or be viewed as a tacit endorsement of the condition of components or features that do not appear in this summary report.

Exterior

Grading and Drainage

Surface Drainage

1.1 -- COMMENTS: Surface drainage within 10 feet satisfactory

1.2 -- MAINTENANCE: Area drains not tested

Elevations

1.3 -- COMMENTS: Exterior grade and interior floor elevations adequate

Grading

1.4 -- COMMENTS: Grading conditions appeared satisfactory

Hardscaping

Patio

1.5 -- COMMENTS: The patio is functional

Driveway

1.6 -- MAINTENANCE: Asphalt driveway cracked or deteriorating

Site Features

Vegetation

1.7 -- COMMENTS: Foliage growing on structure needs removal

1.8 -- MAINTENANCE: Tree limbs overgrowing structure need trimming

Watering System

1.9 -- DEFERRED: Sprinkler system installed but not inspected

Building Features

Wall Coverings

1.10 -- DEFICIENT: Moisture damage at base of wall covering

1.11 -- DEFERRED: Wall coverings not tested for watertightness

1.12 -- COMMENTS: Wall covering appears functional

Fascia and Trim

1.13 -- COMMENTS: Fascia board and trim appears satisfactory

Eaves and Soffits

1.14 -- COMMENTS: Eaves or soffits in satisfactory condition

Doors and Windows

1.15 -- COMMENTS: Door or window exteriors satisfactory

1.16 -- MAINTENANCE: Window glazing compound cracked or missing

Deck and Patio Covers

1.17 -- COMMENTS: Patio or deck cover is functional

Porches and Stoops

1.18 -- COMMENTS: Porch or stoop is functional

Stairs and Landings

1.19 -- COMMENTS: Attached stairs and landing are functional

Decks and Balconies

1.20 -- PREVENTIVE: Earth to wood contact at deck

1.21 -- COMMENTS: Attached appurtenance appears functional

Railings

1.22 -- COMMENTS: Handrailings and guardrailings are functional

Structural

Structure & Framing

Wall Structure

2.1 -- COMMENTS: Wall structure appeared functional

2.2 -- COMMENTS: Walls are conventionally framed with studs

Floor Structure

2.3 -- COMMENTS: The floor structure appeared functional

2.4 -- COMMENTS: Floor type and construction materials

Ceiling and Roof Structure

2.5 -- COMMENTS: Ceiling and roof structure functional

2.6 -- COMMENTS: Ceiling and roof structure framing type

Slab Foundation

General Comments

2.7 -- COMMENTS: The structure has a concrete slab foundation

Concrete Slab

2.8 -- COMMENTS: Concrete slab foundation appears satisfactory

Footings

2.9 -- DEFERRED: Footing presence or depth below soil not verified

Garage Foundation

General Comments

2.10 -- COMMENTS: Garage rests upon a slab foundation

Concrete Slab

2.11 -- COMMENTS: The garage slab has some typical cracking

Footings

2.12 -- DEFERRED: Footing presence or depth below soil not verified

Roof

Primary Roof

General Comments

3.1 -- COMMENTS: Sloped roof information

Roof Access

3.2 -- COMMENTS: Roof was walked on for the inspection

Composition Shingle

3.3 -- PREVENTIVE: Branches or foliage overgrowing roof need removal

3.4 -- COMMENTS: Composition shingle roof covering satisfactory

3.5 -- MAINTENANCE: Growth needs to be cleared off

Flashings

3.6 -- MONITOR: Wide chimney over 30 inches without cricket diverter

3.7 -- COMMENTS: Roof flashing appears satisfactory

Protrusions

3.8 -- PREVENTIVE: vent pipe too short

3.9 -- COMMENTS: Protrusions appeared satisfactory

Roof Drainage

3.10 -- DEFICIENT: Downspouts missing or need service

3.11 -- COMMENTS: Roof drainage appears satisfactory

Attic and Loft

Attic

General Comments

4.1 -- DEFERRED: Attic inspection limitations

4.2 -- DEFERRED: Areas of attic not accessible for evaluation

4.3 -- DEFERRED: Attic insulation limited inspection

Access

4.4 -- COMMENTS: Access provided to enter and evaluate attic

Ventilation

4.5 -- DEFICIENT: No visible ventilation for attic areas

Insulation

4.6 -- COMMENTS: Attic floor appears sufficiently insulated

4.7 -- COMMENTS: Insulation falling or hanging from walls

Electrical

Service

Service Entrance

5.1 -- COMMENTS: Service entrance type

Service Lines

5.2 -- COMMENTS: Utility service line capacity

Service Disconnect

5.3 -- COMMENTS: Main disconnect size and location

Grounding Electrode System

5.4 -- COMMENTS: Main panel appears correctly grounded

Main Panel

Main Panel

5.5 -- DEFERRED: Inspector does not perform load-calculations

5.6 -- COMMENTS: Main panel size and location

5.7 -- COMMENTS: Main panel has no visible deficiencies

Panel Covers

5.8 -- COMMENTS: Interior and exterior panel covers satisfactory

Circuit Breakers

5.9 -- COMMENTS: Circuit breakers in main panel satisfactory

Sub Panel

Sub Panel

5.10 -- DEFERRED: Inspector does not perform load-calculations

5.11 -- COMMENTS: Sub panel has no visible deficiencies

Panel Covers

5.12 -- COMMENTS: Interior and exterior panel covers satisfactory

Circuit Breakers

5.13 -- SAFETY: A breaker is serving two circuits

Grounding

5.14 -- COMMENTS: Sub panel appears correctly grounded

Wiring

Wiring Types

5.15 -- COMMENTS: Branch circuit wiring types and materials

Branch Circuit Wiring

5.16 -- COMMENTS: Wiring appears satisfactory

Exterior Wiring

5.17 -- COMMENTS: Exterior wiring appears satisfactory

Interior Wiring

5.18 -- COMMENTS: Interior wiring appears satisfactory

Kitchen Wiring

5.19 -- COMMENTS: Kitchen wiring appears satisfactory

Garage Wiring

5.20 -- COMMENTS: Garage wiring appears satisfactory

Bathroom Wiring

5.21 -- COMMENTS: Bathroom wiring appears satisfactory

Attic Wiring

5.22 -- COMMENTS: Attic wiring appears satisfactory

Lights and Switches

Interior and Exterior

5.23 -- COMMENTS: All tested lights and switches were functional

Receptacle Outlets

Interior and Exterior

5.24 -- COMMENTS: All tested receptacle outlets were functional

Inspection Limitations

5.25 -- DEFERRED: Inspection limited to outlets that were visible

5.26 -- DEFERRED: Only a sampling of outlets were tested

GFCI Protection

General Comments

5.27 -- COMMENTS: GFCI technology life-saving but can fail

GFCI Receptacle Outlets

5.28 -- COMMENTS: GFCI outlets responded correctly

Inspection Limitations

5.29 -- DEFERRED: GFCI tested with manufacturers test buttons

Fan Fixtures

Fans

5.30 -- COMMENTS: Fans were found to be fully functional

Plumbing

Water Supply System

Water Main Shut Off

6.1 -- COMMENTS: Water main shut off valve not located

Functional Flow

6.2 -- COMMENTS: Water flow at supply fixtures appears functional

Supply Pipes and Connectors

6.3 -- COMMENTS: Potable water supply pipes appear satisfactory

Hose Bibs

6.4 -- COMMENTS: The hose bibs are functional

Inspection Limitations

6.5 -- DEFERRED: Water quality or potability not tested

6.6 -- DEFERRED: Shut-off valves not evaluated or tested

Drainage and Venting System

General Comments

6.7 -- COMMENTS: Drain, waste and vent system information

Drain and Vent Pipes

6.8 -- COMMENTS: Drainage and vent piping materials

6.9 -- COMMENTS: Drain and vent pipes are functional

Plumbing Fixtures

Sinks

6.10 -- COMMENTS: Sinks and related components functional

Toilets

6.11 -- COMMENTS: The toilets in the home are functional

Stall Showers

6.12 -- PREVENTIVE: Discoloration in flooring at base of stall shower

6.13 -- COMMENTS: The two stall showers are functional

Tub-Showers

6.14 -- COMMENTS: The tub-shower is functional

Tubs

6.15 -- COMMENTS: The tub is functional

Inspection Limitations

6.16 -- DEFERRED: Shower pans and enclosures not water tested

6.17 -- DEFERRED: Tub and sink overflows not filled or tested

Water Heater

Water Heater

6.18 -- COMMENTS: Water heater information

6.19 -- COMMENTS: Water heater functioning satisfactorily

6.20 -- COMMENTS: Useful life of older water heater not determinable

Controls

6.21 -- COMMENTS: Control valve handle or knob functional

Combustion Chamber

6.22 -- COMMENTS: Combustion chamber appears satisfactory

Combustion Air

6.23 -- COMMENTS: Combustion air supply appears adequate

Water Line Connectors

6.24 -- COMMENTS: Water lines and connectors satisfactory

TPR Valve

6.25 -- PREVENTIVE: TPR valve discharge pipe incorrectly plumbed uphill

Drip Pan

6.26 -- PREVENTIVE: No drip pan or overflow pipe provided

Venting Provisions

6.27 -- COMMENTS: Vent pipe and cap appear functional

Gas Shut-Off Valve

6.28 -- COMMENTS: Gas control valve and connector functional

Drain Valve

6.29 -- COMMENTS: Drain valve satisfactory or not leaking

Water Shut-Off Valve

6.30 -- COMMENTS: Shut-off valve and water line connectors functional

Water Heater #2

Water Heater

6.31 -- COMMENTS: Water heater information

6.32 -- COMMENTS: Water heater functioning satisfactorily

6.33 -- COMMENTS: Useful life of older water heater not determinable

Controls

6.34 -- COMMENTS: Control valve handle or knob functional

Combustion Chamber

6.35 -- COMMENTS: Combustion chamber appears satisfactory

Combustion Air

6.36 -- COMMENTS: Combustion air supply appears adequate

Water Line Connectors

6.37 -- COMMENTS: Water lines and connectors satisfactory

TPR Valve

6.38 -- PREVENTIVE: TPR valve discharge pipe incorrectly plumbed uphill

Drip Pan

6.39 -- PREVENTIVE: No drip pan or overflow pipe provided

Venting Provisions

6.40 -- COMMENTS: Vent pipe and cap appear functional

Gas Shut-Off Valve

6.41 -- COMMENTS: Gas control valve and connector functional

Drain Valve

6.42 -- COMMENTS: Drain valve satisfactory or not leaking

Water Shut-Off Valve

6.43 -- COMMENTS: Shut-off valve and water line connectors functional

Gas Supply System

Meter and Main

6.44 -- COMMENTS: Gas meter appeared satisfactory

Gas Shut-Off

6.45 -- COMMENTS: Gas shut-off valve located at gas main

Lines and Valves

6.46 -- COMMENTS: Gas supply system appear satisfactory

Heating

Forced Air Furnace

General Comments

7.1 -- COMMENTS: Forced-air heating system information

Furnace

7.2 -- COMMENTS: Forced air furnace responded to user controls

7.3 -- COMMENTS: Forced air gas furnace system satisfactory

Combustion Air

7.4 -- DEFERRED: Combustion-air for furnace appears adequate

Vent Pipe and Termination

7.5 -- COMMENTS: Venting system components appear satisfactory

Gas Valve and Connector

7.6 -- COMMENTS: Gas valve and connector satisfactory

Air Filter

7.7 -- COMMENTS: Air filter is clean or relatively clean

Return Air System

7.8 -- COMMENTS: Return air compartment satisfactory

Distribution System

7.9 -- COMMENTS: Distribution ducts in satisfactory condition

Heat Exchanger

7.10 -- DEFERRED: Dismantling of furnace not performed

Service Life

7.11 -- COMMENTS: Remaining service life of older furnace unknown

Forced Air Furnace #2

General Comments

7.12 -- COMMENTS: Forced-air heating system information

Furnace

7.13 -- COMMENTS: Forced air furnace responded to user controls

7.14 -- COMMENTS: Forced air gas furnace system satisfactory

Combustion Air

7.15 -- DEFERRED: Combustion-air for furnace appears adequate

Vent Pipe and Termination

7.16 -- COMMENTS: Venting system components appear satisfactory

Gas Valve and Connector

7.17 -- COMMENTS: Gas valve and connector satisfactory

Air Filter

7.18 -- COMMENTS: Air filter is clean or relatively clean

Return Air System

7.19 -- COMMENTS: Return air compartment satisfactory

Distribution System

7.20 -- COMMENTS: Distribution ducts in satisfactory condition

Heat Exchanger

7.21 -- DEFERRED: Dismantling of furnace not performed

Heating and Cooling

Split System

Cooling

8.1 -- COMMENTS: Cooling system responded to user controls

8.2 -- COMMENTS: Cooling system component information

Condensate Drainage

8.3 -- COMMENTS: Condensate discharge pipes appear functional

Split System #2

Cooling

8.4 -- COMMENTS: Cooling system responded to user controls

8.5 -- COMMENTS: Cooling system component information

Condensate Drainage

8.6 -- COMMENTS: Condensate discharge pipes appear functional

Fireplace

Masonry

Fireplace

9.1 -- DEFERRED: NFPA recommends annual inspection

9.2 -- COMMENTS: Masonry fireplace

9.3 -- COMMENTS: Masonry fireplace system has no visible defects

Chimney

9.4 -- DEFERRED: Chimney has settled away from structure

Rain Cap

9.5 -- COMMENTS: Weather cap on chimney is satisfactory

Spark Arrestor

9.6 -- COMMENTS: Spark arrestor appears satisfactory

Interior

General

Interior Inspection

10.1 -- DEFERRED: Interior inspection information

Important Observations

10.2 -- SAFETY: Sunken living room a potential hazard

Floors

Floor Coverings

10.3 -- COMMENTS: Floor coverings are functional

10.4 -- COMMENTS: Floor coverings are satisfactory

Walls and Ceilings

Walls

10.5 -- DEFICIENT: There is damage to the wall covering

10.6 -- DEFERRED: Moisture damage to the wall covering

Ceilings

10.7 -- DEFERRED: Moisture-like staining in ceiling

10.8 -- COMMENTS: Ceiling coverings are functional

Windows

Windows

10.9 -- COMMENTS: All tested windows were functional

Doors

Main Entry

10.10 -- COMMENTS: Main entry door is functional

Exterior

10.11 -- COMMENTS: Exterior doors satisfactory

Interior

10.12 -- DEFICIENT: interior door needs service

10.13 -- COMMENTS: Interior doors satisfactory

Closets

10.14 -- COMMENTS: Closet doors satisfactory

Stairs and Landings

Handrails

10.15 -- COMMENTS: Handrailings appear functional

Stairs

10.16 -- COMMENTS: Stairs and landing appear satisfactory

Built-In Appliances

Appliances

10.17 -- COMMENTS: Appliances tested for primary functionality only

Dishwasher

10.18 -- COMMENTS: Dishwasher responded to controls

Garbage Disposal

10.19 -- COMMENTS: Garbage disposal responded

Gas Cook Top

10.20 -- COMMENTS: Gas cook top responded to controls

Electric Oven

10.21 -- COMMENTS: Electric oven responded to controls

Microwave

10.22 -- COMMENTS: Microwave oven responded to controls

Laundry Provisions

Laundry Provisions

10.23 -- DEFERRED: Freestanding laundry appliances not inspected

10.24 -- COMMENTS: Laundry provisions location

Washer Drainage

10.25 -- COMMENTS: Washer drain line present but not filled or tested

Dryer Venting

10.26 -- COMMENTS: Dryer exhaust provisions were satisfactory

Gas Supply

10.27 -- COMMENTS: Gas line and valve appears satisfactory

Electrical Supply

10.28 -- COMMENTS: 220v outlet was provided

Smoke Alarms

Placement

10.29 -- COMMENTS: Smoke detector installed in bedroom

10.30 -- COMMENTS: Smoke detector installed in bedroom hallway

10.31 -- COMMENTS: Smoke detector installed at top of stairs

Testing

10.32 -- DEFERRED: Smoke detectors not tested

10.33 -- DEFERRED: Smoke detectors need testing prior to occupation

Ventilation and Exhaust

Bathroom

10.34 -- COMMENTS: The bathroom exhaust fans are functional

Other Components

Doorbells

10.35 -- COMMENTS: Doorbell responded

Garage

Interior

General Comments

11.1 -- COMMENTS: Garages dimensions vary

Windows

11.2 -- COMMENTS: Garage windows functional

Walls and Ceiling

11.3 -- COMMENTS: The wall coverings are functional

11.4 -- COMMENTS: Ceiling coverings are functional

Vehicle Doors

Vehicle Doors

11.5 -- COMMENTS: Two or more vehicle doors functional

General

Environmental Comments

Pest Control

12.1 -- COMMENTS: Your home inspector is not a pest control operator

1605 Quail Ln INSPECTION REPORT (LBHI #10827)

Exterior

Grading and Drainage

Surface Drainage

1.1 - COMMENTS: Surface drainage conditions within 10 feet of the inspected structure(s) appeared satisfactory.

1.2 - MAINTENANCE: The property is served by one or more area drains that are not filled or tested by your home inspector. However, because dirt and/or debris can block the pipes, they should be tested (flushed through) to determine whether or not the drain line(s) are currently functional. The lines must be maintained and tested annually, and the drain covers evaluated regularly for damage.



Elevations

1.3 - COMMENTS: There appears to be an adequate difference in elevation between the exterior grade and the interior floors.

Grading

1.4 - COMMENTS: Surface drainage conditions within 10 feet of the inspected structure(s) appeared satisfactory.

Hardscaping

Patio

1.5 - COMMENTS: The stone patio at the north side of the residence is functional.



Driveway

1.6 - MAINTENANCE: Although functional, the asphalt driveway has not been maintained and is cracked and/or deteriorating in some areas. As a preventive measure, we recommend that all cracks be filled/sealed and that the driveway be re-coated or resurfaced to extend its life span.











Site Features

Vegetation

1.7 - COMMENTS: There is foliage growing on or against the south side of the residence that we recommend be removed or trimmed back to help prevent damage to the wall coverings.



1.8 - MAINTENANCE: There are tree limbs overgrowing the south side of the home and the east side of the home that should be trimmed and/or monitored regularly to insure that they do not cause any physical damage.



Watering System

1.9 - DEFERRED: A sprinkler system is installed on the property. However, since evaluation of any type of grounds watering system is outside the scope of a home inspection, you may wish to have a landscaping contractor evaluate the system before the close of the transaction. In any event, it is important that you make sure the sprinklers do not spray against the residence, or create water pooling around the base of the

home, as water can cause damage to the foundation and exterior, and can also lead to moisture intrusion and mold growth within the home.

Building Features

Wall Coverings

1.10 - DEFICIENT: There is moisture damage at the base of the wood wall covering at the south side of the residence that needs to be repaired.



1.11 - DEFERRED: The wall coverings and building envelope are not tested for watertightness, and we do not guarantee or provide any type of warranty against moisture intrusion.

1.12 - COMMENTS: The wood wall covering is in satisfactory condition.

Fascia and Trim

1.13 - COMMENTS: The fascia board and trim appears to be in satisfactory condition.

Eaves and Soffits

1.14 - COMMENTS: The eaves and soffits are in satisfactory condition.

Doors and Windows

1.15 - COMMENTS: The door exteriors are in satisfactory condition.

1.16 - MAINTENANCE: The glazing compound at the window at the south side of the residence is cracked or missing and needs repair or replacement.



Deck and Patio Covers

1.17 - COMMENTS: The deck cover at the south side of the residence is functional.

Porches and Stoops

1.18 - COMMENTS: The stoop at the south side of the residence appears functional.



Stairs and Landings

1.19 - COMMENTS: The attached wood stairs at the east side of the residence appears functional.



Decks and Balconies

1.20 - PREVENTIVE: Earth to wood contact was observed at the deck at the north side of the residence. All untreated wood or wood framing members should maintain a minimal 6 in. clearance from the soil to prevent moisture or termite damage.



1.21 - COMMENTS: The attached deck at the north side of the residence is in functional condition.



Railings

1.22 - COMMENTS: The handrailings and guardrailings stairs at the attached wood stairs at the north side of the residence appear functional.

Structural

Structure & Framing

Wall Structure

2.1 - COMMENTS: The wall structure components appear functional.

2.2 - COMMENTS: The walls of the home would appear to be conventionally framed with 2x4 wood studs.

Floor Structure


2.3 - COMMENTS: Where visible, the floor structure components appeared functional.

2.4 - COMMENTS: The floor of the home is constructed of poured concrete.

Ceiling and Roof Structure

2.5 - COMMENTS: The ceiling and roof structure appeared functional.

2.6 - COMMENTS: The ceiling and roof structure is framed with 2x6 wood joists and rafters.

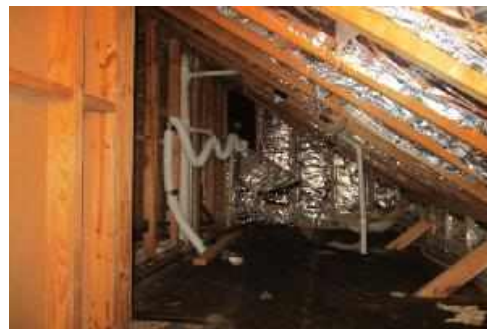

Slab Foundation

General Comments

2.7 - COMMENTS: The residence has a concrete slab foundation. Not all slab foundations are alike, however. For example, steel reinforcement bars and moisture barriers were not used in earlier slabs, but are included in most new slabs. Some slabs are post-tension, which incorporate the use of cable that is put under tension to help prevent cracking. In any event, our inspection of slab foundations includes checking the visible portions of the slab and perimeter stem walls for any significant cracks or structural deformation. However, we do not move furniture or remove the floor coverings, nor do we use any specialized measuring equipment. It is, however, important to note that most concrete slabs are found to contain cracks when the floor coverings are removed, but cracks that are less than 1/4" and are not offset are generally not considered to be structurally significant.

Concrete Slab

2.8 - COMMENTS: The visible portions of the concrete slab foundation appeared to be in satisfactory condition at the time of the inspection.

Footings

2.9 - DEFERRED: The Inspector does not verify the presence and depth of footings below the soil line.

Garage Foundation

General Comments

2.10 - COMMENTS: The garage rests upon a slab foundation. Our inspection of slab foundations includes checking the visible portions of the slab and perimeter stem walls for any evidence of significant cracks or structural deformation, but we do not move stored items or vehicles.



Concrete Slab

2.11 - COMMENTS: The garage slab has some typical cracking usually associated with shrinkage, settlement, expansion, etc, but do not appear to be structurally threatening.



Footings

2.12 - DEFERRED: The Inspector does not verify the presence and depth of footings below the soil line.

Roof

Primary Roof

General Comments

3.1 - COMMENTS: The residence has a sloped or pitched roof. Most sloped roofs are covered with individual pieces of shingle or tile material that is overlapped to prevent water penetration. The slope of a roof is usually a factor in the life expectancy of the roofing material. The life expectancy of a roof covering is also dependent upon the type of material used, the quality of workmanship, exposure to sun and wear from tree branches, snow or ice, and wind. Asphalt shingle is the most common roofing material used on sloped

or pitched roofs. Other types of covering for sloped roofs include asphalt roll roofing, concrete or clay tiles, wood shakes and shingles, and slate shingles. There are also fiberglass shingles, metal shingles and metal sheet roofing systems.

Roof Access

3.2 - COMMENTS: The roof was walked on for the inspection.



Composition Shingle

3.3 - PREVENTIVE: There are tree branches or foliage overgrowing the roof at the north side of the residence that you need to have removed or trimmed back to help prevent damage and/or premature wear to the roof coverings.



3.4 - COMMENTS: The composition shingle roofing material appeared to be in satisfactory condition relative to its age. The roof was walked on for the inspection.



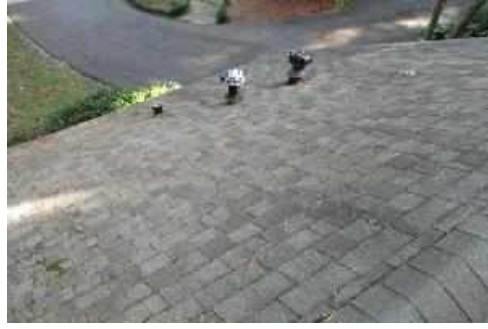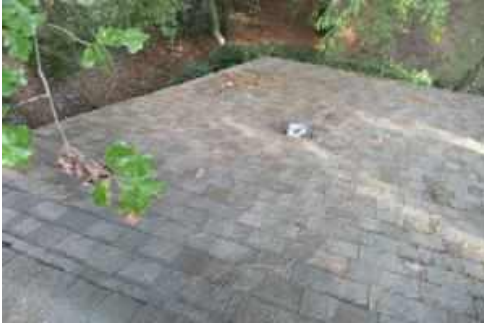



3.5 - MAINTENANCE: There are algae growth that need to be cleared off to help prevent premature deterioration of the coverings and to facilitate drainage.



Flashings

3.6 - MONITOR: There is a chimney at the north side of the residence that is over 30 inches wide and does not have diverter flashings to help prevent water from pooling at the roof area directly behind it. This area is a common point for damming and leakage, and must be monitored regularly and kept clear of debris.



3.7 - COMMENTS: The roof flashing, where visible, appears to be in satisfactory condition. Flashing is an impervious material (usually galvanized sheet metal) that comes in a variety of shapes and sizes and is used to cover, waterproof, and direct water away from roof penetrations and from intersections between the roof covering and other materials.

Protrusions

3.8 - PREVENTIVE: The vent pipe on the east side is too short and could allow water to drain in from the roof. I Recommend repairing the vent pipe.



3.9 - COMMENTS: Where visible, the roof protrusions (vent pipes, etc.) appeared to be well sealed and/or flashed and in satisfactory condition.

Roof Drainage

3.10 - DEFICIENT: Some downspouts are missing or need to be reconnected or serviced.



3.11 - COMMENTS: The gutters and downspouts that were installed appeared to be in satisfactory condition. However, without water in the gutters it is virtually impossible to determine whether they are watertight and properly sloped towards the downspouts, so you may wish to have the system water tested for proper function at this time, or take your chances and wait for the next heavy rainfall to evaluate the system.

Attic and Loft

Attic

General Comments

4.1 - DEFERRED: We will inspect the attic as best as we possibly can from all accessible vantage points. However, we will usually not try to enter an attic that is less than thirty-six inches high, or where passage is restricted by framing, furnaces, distribution ducting, etc, nor will we attempt to access any areas where the insulation conceals the framework that would otherwise provide a visible secure footing. With regards to insulation, we do not attempt to determine its R-value, do not sample or test its composition for hazardous content, and use approximate measurements and descriptive terminology. Also, since we do not move or disturb the insulation during our inspection, components such as water pipes, electrical conduits, junction boxes, exhaust fans, etc. may not be visible for evaluation.

4.2 - DEFERRED: The section of the upstairs attic space is not accessible.

4.3 - DEFERRED: Attic insulation limited inspection of attic areas and components.

Access

4.4 - COMMENTS: There is a clear access to the attic in the master bedroom closet and two upstairs doors that was entered in order to evaluate the attic areas and components.



Ventilation

4.5 - DEFICIENT:

There is no attic ventilation and you should consult an appropriately qualified specialist about correcting this adverse condition.

NOTE: Not all the attic was accessible.

Insulation

4.6 - COMMENTS: The attic floor is insulated with approximately 5 inches of fiberglass batt insulation, which should be adequate.

4.7 - COMMENTS: Some pieces or sections of insulation have fallen from the attic walls or are hanging down from the walls that will need to be corrected.



Electrical

Service

Service Entrance

5.1 - COMMENTS: The service entrance is underground.



Service Lines

5.2 - COMMENTS: The service line capacity is 200 amps and 220 volts.

Service Disconnect

5.3 - COMMENTS: The 200 amp main disconnect is located inside the main panel.



Grounding Electrode System

5.4 - COMMENTS: The main electrical panel appears to be properly grounded.



Main Panel

Main Panel

5.5 - DEFERRED: Load-calculations were not conducted in an effort to determine if the main panel and its components will meet the demands of the residence and/or its new occupants.

5.6 - COMMENTS: The residence is served by what appears to be a 200 amp panel, located at the east side of the residence.



5.7 - COMMENTS: The main panel and its components have no visible deficiencies.

Panel Covers

5.8 - COMMENTS: The interior and exterior covers at the main panel appear functional.



Circuit Breakers

5.9 - COMMENTS: There were no visible deficiencies with the circuit breakers in the main electrical panel.



Sub Panel

Sub Panel

5.10 - DEFERRED: Load-calculations were not conducted in an effort to determine if the sub panel and its components will meet the demands of the residence and/or its new occupants.

5.11 - COMMENTS: The sub panel and its components have no visible deficiencies.



Panel Covers

5.12 - COMMENTS: The interior and exterior covers at the sub panel appear functional.



Circuit Breakers

5.13 - SAFETY: One of the breakers in the sub panel is serving two circuits. This creates a potential fire-hazard that should be corrected by an appropriately qualified specialist.



Grounding

5.14 - COMMENTS: The sub panel appears to be properly grounded.

Wiring

Wiring Types

5.15 - COMMENTS: Where visible and accessible, the branch circuit wiring in this residence is primarily vinyl-wrapped NM copper.

Branch Circuit Wiring

5.16 - COMMENTS: We observed no deficiencies with the visible and accessible branch circuit wiring at the time of the inspection.

Exterior Wiring

5.17 - COMMENTS: We observed no deficiencies with the visible and accessible exterior branch circuit wiring at the time of the inspection.

Interior Wiring

5.18 - COMMENTS: We observed no deficiencies with the visible and accessible interior branch circuit wiring at the time of the inspection.

Kitchen Wiring

5.19 - COMMENTS: We observed no deficiencies with the visible and accessible kitchen branch circuit wiring at the time of the inspection.

Garage Wiring

5.20 - COMMENTS: We observed no deficiencies with the visible and accessible garage branch circuit wiring at the time of the inspection.

Bathroom Wiring

5.21 - COMMENTS: We observed no deficiencies with the visible and accessible bathroom branch circuit wiring at the time of the inspection.

Attic Wiring

5.22 - COMMENTS: We observed no deficiencies with the visible and accessible attic branch circuit wiring at the time of the inspection.

Lights and Switches

Interior and Exterior

5.23 - COMMENTS: All tested interior and exterior light fixtures and switches were functional.

Receptacle Outlets

Interior and Exterior

5.24 - COMMENTS: All tested interior and exterior receptacle outlets were functional.

Inspection Limitations

5.25 - DEFERRED: Our inspection was limited to visible and accessible outlets only. Those outlets that were concealed or inaccessible due to stored items, furniture, etc. were not tested or inspected. Only a representative sampling of outlets were tested.

5.26 - DEFERRED: Only a representative sampling of outlets were tested.

GFCI Protection

General Comments

5.27 - COMMENTS: Ground fault circuit interruption (GFCI) technology is life-saving and very important, but these devices can fail at any time. We recommend that you carefully test all GFCI devices for proper function on a regular basis using the manufacturers test button(s).

GFCI Receptacle Outlets

5.28 - COMMENTS: The GFCI protected receptacle outlets at the home responded correctly when tested using the built-in test buttons.

Inspection Limitations

5.29 - DEFERRED: GFCI equipment was tested using the manufacturers test buttons only.

Fan Fixtures

Fans

5.30 - COMMENTS: All tested fan fixtures responded to normal user controls.

Plumbing

Water Supply System

Water Main Shut Off

6.1 - COMMENTS: The water main shut off valve could not be located and/or there does not appear to be a valve to turn off the water to the house. A shut-off is needed to facilitate a quick shutdown of the water supply in the event of a leak or similar emergency, and we would recommend that one be installed at the house as a preventive measure.

Functional Flow

6.2 - COMMENTS: The water flow at the plumbing fixtures appeared functional. However, as water flow is a matter of personal desirability, and as temperature and flow fluctuations will often occur when other fixtures are operated simultaneously, we suggest that the client(s) test the flow at the shower(s) while operating other fixtures in order to determine whether or not it meets with their requirements.

Supply Pipes and Connectors

6.3 - COMMENTS: The potable water pipes, where visible, are copper, and appear to be in satisfactory condition.

Hose Bibs

6.4 - COMMENTS: The hose bibs are functional.

Inspection Limitations

6.5 - DEFERRED: Water quality or potability of water supply was not evaluated or tested.

6.6 - DEFERRED: The shut-off valves at the supply fixtures were not handled as they are subject to leakage when turned.

Drainage and Venting System

General Comments

6.7 - COMMENTS: We test the drain, waste and vent (DWV) system by running water through every fixture drain and watching for blockages or slow drains. Fixture blockages become quickly evident and can usually be cured by clearing out the traps. However, if the main drain line is blocked or damaged, there is a very strong chance that it will not become apparent during the course of our inspection, and for this reason we strongly recommend that you have it video scanned by an appropriately qualified specialist to determine its present condition.

Drain and Vent Pipes

6.8 - COMMENTS: The drainage and vent piping is predominantly schedule 40 PVC.

6.9 - COMMENTS: The fixture drain and vent pipes within the home were functional at the time of the inspection.

Plumbing Fixtures

Sinks

6.10 - COMMENTS: The kitchen and bathroom sinks and related components are functional.






Toilets

6.11 - COMMENTS: The toilets responded properly when flushed.



Stall Showers

6.12 - PREVENTIVE: There is discoloration in the vinyl floor covering at the base of the master bathroom stall shower that suggests that it may be leaking or has leaked at some time in the past. Because testing stall shower enclosures for watertightness falls outside the scope of a home inspection, you may wish to have this condition evaluated by an appropriately qualified specialist to determine if the enclosure is watertight as needed.

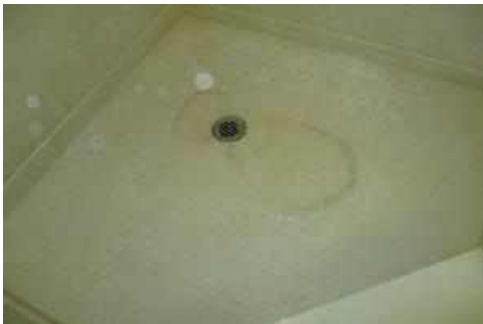

6.13 - COMMENTS: The stall showers in the hall bathroom and master bathroom are functional.



Tub-Showers

6.14 - COMMENTS: The tub-shower in the hall bathroom is functional.



Tubs

6.15 - COMMENTS: The tub in the master bathroom is functional.



Inspection Limitations


6.16 - DEFERRED: Shower stall surrounds are not tested for watertightness.

6.17 - DEFERRED: Tub and sink overflows are not filled or tested as a part of our inspection.

Water Heater

Water Heater

6.18 - COMMENTS: There is a 32 year old, 40 gallon, A.O. SMITH natural gas water heater located in the garage.

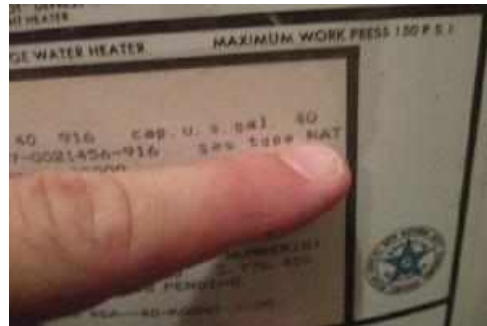

6.19 - COMMENTS: The water heater was functioning satisfactorily at the time of the inspection, with no evidence of prior or active leakage observed.

6.20 - COMMENTS: The remaining useful life of the older water heater is not determinable. If a water heater has exceeded its factory warranty, as this one apparently has, it can fail at any time, and you may wish to purchase a home warranty to help defray the cost of replacing it and any other appliances in the home.

Controls

6.21 - COMMENTS: The control valve handle or knob was functional.



Combustion Chamber

6.22 - COMMENTS: The combustion chamber is free of leakage and excessive rust or corrosion.

Combustion Air

6.23 - COMMENTS: The water heater appears to have an adequate combustion-air supply.

Water Line Connectors

6.24 - COMMENTS: The water supply lines and connectors appeared to be in satisfactory condition.



TPR Valve

6.25 - PREVENTIVE: The discharge line from the temperature and pressure relief (TPR) valve has been incorrectly plumbed uphill, which can allow any discharge to remain in the line and damage the valve, and the line should be correctly plumbed downhill for safety.



Drip Pan

6.26 - PREVENTIVE: The water heater was not equipped with a drip pan or overflow pipe to minimize water damage from a leak, and you may wish to install a drip pan and overflow pipe as a preventative measure.



Venting Provisions

6.27 - COMMENTS: The vent pipe and cap on the gas water heater appeared to be functional.



Gas Shut-Off Valve

6.28 - COMMENTS: The gas control valve and connector appear to be functional.



Drain Valve

6.29 - COMMENTS: A drain valve was installed on the water heater. No leakage was noted. However, our evaluation did not include turning or testing of the drain valve.

Water Shut-Off Valve

6.30 - COMMENTS: The shut-off valve and water line connectors on the water heater appeared functional. To avoid possible leakage, our evaluation does not include turning or testing of the shut-off valve.



Water Heater #2

Water Heater

6.31 - COMMENTS: There is a 21 year old, 75 gallon, RUUD natural gas water heater located in the utility room.



6.32 - COMMENTS: The water heater was functioning satisfactorily at the time of the inspection, with no evidence of prior or active leakage observed.

6.33 - COMMENTS: The remaining useful life of the older water heater is not determinable. If a water heater has exceeded its factory warranty, as this one apparently has, it can fail at any time, and you may wish to purchase a home warranty to help defray the cost of replacing it and any other appliances in the home.

Controls

6.34 - COMMENTS: The control valve handle or knob was functional.



Combustion Chamber

6.35 - COMMENTS: The combustion chamber is free of leakage and excessive rust or corrosion.

Combustion Air

6.36 - COMMENTS: The water heater appears to have an adequate combustion-air supply.

Water Line Connectors

6.37 - COMMENTS: The water supply lines and connectors appeared to be in satisfactory condition.



TPR Valve

6.38 - PREVENTIVE: The discharge line from the temperature and pressure relief (TPR) valve has been incorrectly plumbed uphill, which can allow any discharge to remain in the line and damage the valve, and the line should be correctly plumbed downhill for safety.



Drip Pan

6.39 - PREVENTIVE: The water heater was not equipped with a drip pan or overflow pipe to minimize water damage from a leak, and you may wish to install a drip pan and overflow pipe as a preventative measure.



Venting Provisions

6.40 - COMMENTS: The vent pipe and cap on the gas water heater appeared to be functional.



Gas Shut-Off Valve

6.41 - COMMENTS: The gas control valve and connector appear to be functional.



Drain Valve

6.42 - COMMENTS: A drain valve was installed on the water heater. No leakage was noted. However, our evaluation did not include turning or testing of the drain valve.

Water Shut-Off Valve

6.43 - COMMENTS: The shut-off valve and water line connectors on the water heater appeared functional. To avoid possible leakage, our evaluation does not include turning or testing of the shut-off valve.



Gas Supply System

Meter and Main

6.44 - COMMENTS: The gas meter appeared to be in satisfactory condition, and is located at the east side of the residence.



Gas Shut-Off

6.45 - COMMENTS: The gas shut-off valve is located at the gas main.



Lines and Valves

6.46 - COMMENTS: Where visible, the gas supply system appears to be in satisfactory condition.

Heating

Forced Air Furnace

General Comments

7.1 - COMMENTS: A forced-air or warm air heating system is one which uses air as its heat transfer medium. These systems use ductwork and vents as a means of air distribution. The return plenum carries the air from several large return grills to a central air handler for re-heating. The supply plenum directs heated air from the central unit to registers in the rooms which the system is designed to heat. Regardless of type, all air handlers consist of an air filter, blower, heat exchanger/element/coil, and various controls. Like any other kind of central heating system, thermostats are used to control forced air heating systems.

Furnace

7.2 - COMMENTS: The 15 year old, 60,000 btu AMERICAN STANDARD gas-fired forced air heating unit is located in the garage. The furnace responded to normal user controls at the time of the inspection.



7.3 - COMMENTS: All forced air heating system components appeared satisfactory. These components include the vent pipe and vent cap, the gas valve and connector, the combustion air supply, the air filter, and the return air compartment and distribution system.

Combustion Air

7.4 - DEFERRED: The combustion-air supply for the gas furnace appeared adequate and will need to be evaluated by an appropriately qualified specialist for further remarks and recommendations.

Vent Pipe and Termination

7.5 - COMMENTS: The furnace venting system components appear satisfactory.

Gas Valve and Connector

7.6 - COMMENTS: The gas valve and connector appear to be in satisfactory condition.

Air Filter

7.7 - COMMENTS: At the time of the inspection, the air filter was clean or relatively clean and did not need replacement. However, it is important to replace or clean the filter (depending on type) every two or three months. If filters are not changed (or cleaned) regularly, the ducts can become contaminated, and can be expensive to clean or replace.

Return Air System

7.8 - COMMENTS: The return air compartment appeared to be in satisfactory condition.

Distribution System

7.9 - COMMENTS: Where visible and accessible, the flexible plastic supply ducts were in satisfactory condition.

Heat Exchanger

7.10 - DEFERRED: We do not attempt to dismantle any portion of the system, nor do we evaluate heat exchangers, electronic air-cleaners, humidifiers, and in-line duct motors or dampers. Also, we may not always be able to check every register to determine the adequacy of its air flow.

Service Life

7.11 - COMMENTS: The remaining service life of the furnace in this home is not determinable. However, if a furnace is twenty years or older, as this one is, it can fail at any time, and you may wish to consider purchasing a home warranty to cover its eventual replacement.

Forced Air Furnace #2

General Comments

7.12 - COMMENTS: A forced-air or warm air heating system is one which uses air as its heat transfer medium. These systems use ductwork and vents as a means of air distribution. The return plenum carries the air from several large return grills to a central air handler for re-heating. The supply plenum directs heated air from the central unit to registers in the rooms which the system is designed to heat. Regardless of type, all air handlers consist of an air filter, blower, heat exchanger/element/coil, and various controls. Like any other kind of central heating system, thermostats are used to control forced air heating systems.



Furnace

7.13 - COMMENTS: The 10 year old, 60,000 btu YORK gas-fired forced air heating unit is located in the utility room. The furnace responded to normal user controls at the time of the inspection.

7.14 - COMMENTS: All forced air heating system components appeared satisfactory. These components include the vent pipe and vent cap, the gas valve and connector, the combustion air supply, the air filter, and the return air compartment and distribution system.

Combustion Air

7.15 - DEFERRED: The combustion-air supply for the gas furnace appeared adequate and will need to be evaluated by an appropriately qualified specialist for further remarks and recommendations.

Vent Pipe and Termination

7.16 - COMMENTS: The furnace venting system components appear satisfactory.

Gas Valve and Connector

7.17 - COMMENTS: The gas valve and connector appear to be in satisfactory condition.

Air Filter

7.18 - COMMENTS: At the time of the inspection, the air filter was clean or relatively clean and did not need replacement. However, it is important to replace or clean the filter (depending on type) every two or three months. If filters are not changed (or cleaned) regularly, the ducts can become contaminated, and can be expensive to clean or replace.

Return Air System

7.19 - COMMENTS: The return air compartment appeared to be in satisfactory condition.

Distribution System

7.20 - COMMENTS: Where visible and accessible, the flexible plastic supply ducts were in satisfactory condition.

Heat Exchanger


7.21 - DEFERRED: We do not attempt to dismantle any portion of the system, nor do we evaluate heat exchangers, electronic air-cleaners, humidifiers, and in-line duct motors or dampers. Also, we may not always be able to check every register to determine the adequacy of its air flow.

Heating and Cooling

Split System

Cooling

8.1 - COMMENTS: The split-system central cooling responded to normal user controls at the time of the inspection, with an average differential temperature split of approximately 18 degrees F degrees between the air entering the return and that coming out of the registers.

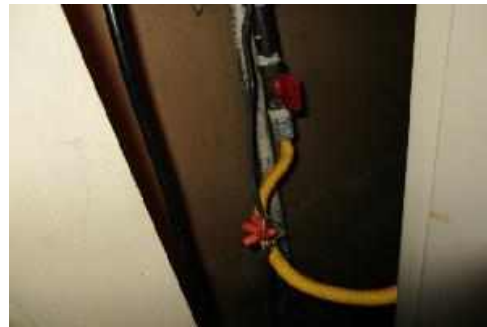

8.2 - COMMENTS: The central air-conditioning in this home is part of a split-system, with a 15 year old, 3 ton AMERICAN STANDARD condensing unit located at the west side of the residence, and a 3 ton AMERICAN STANDARD evaporator coil located at the furnace.

Condensate Drainage

8.3 - COMMENTS: The primary and secondary condensate discharge pipes appear to be functional.

Split System #2

Cooling

8.4 - COMMENTS: The split-system central cooling responded to normal user controls at the time of the inspection, with an average differential temperature split of approximately 18 degrees F degrees between the air entering the return and that coming out of the registers.



8.5 - COMMENTS: The central air-conditioning in this home is part of a split-system, with a 10 year old, 5 ton YORK condensing unit located at the east side of the residence, and a 5 ton YORK evaporator coil located at the furnace.

Condensate Drainage

8.6 - COMMENTS: The primary and secondary condensate discharge pipes appear to be functional.

Fireplace

Masonry**Fireplace**

9.1 - DEFERRED: The NFPA (National Fire Protection Agency) highly recommends an annual inspection of all fireplaces, chimneys, gas appliances and vents. They also recommend that an inspection take place upon the transfer of a property, the replacement of an appliance, an operating malfunction, or following an external event (such as an earthquake) likely to have caused damage. Our inspection of the fireplace and chimney pipe is limited to the readily visible areas and components, and a visual inspection such as that provided by your inspector is not adequate to discover hidden deficiencies or damage should they exist. A NFPA 211 Standard, Level II inspection, which includes cleaning the interior of the chimney pipe and the use of specialized tools and testing procedures, such as video cameras, etc., is needed to thoroughly evaluate the fireplace system. In one has not been performed over the past 12 months, such an inspection is recommended at this time for your safety.


9.2 - COMMENTS: The living room fireplace and chimney system is a single-story stone masonry one. The chimney is mortar-lined brick masonry type.



9.3 - COMMENTS: The masonry fireplace and chimney system has no visible defects.

Chimney

9.4 - DEFERRED: The chimney has settled a distance away from the residence and will need to be evaluated by an appropriately qualified specialist for further remarks and recommendations.

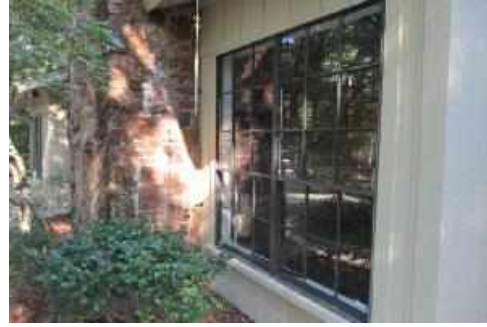

Rain Cap

9.5 - COMMENTS: The weather cap on the chimney is in satisfactory condition.

Spark Arrestor

9.6 - COMMENTS: A spark arrestor was installed and appears to be in satisfactory condition.

Interior

General

Interior Inspection

10.1 - DEFERRED: Our inspection of the interior includes the visually accessible areas of walls, floors, ceilings, counters, cabinets and closets, and includes the testing of a representative number of windows and doors. However, we do not move furniture or the contents of closets or cabinets, lift carpets or rugs, and we do not comment on cosmetic deficiencies. The interior areas are inspected from floor level only and without the use of a ladder.

Important Observations

10.2 - SAFETY: The sunken living room represents a potential trip/fall hazard, and we recommend that you take all necessary precautions to ensure the safety of all those residing at or visiting the property.

Floors

Floor Coverings

10.3 - COMMENTS: The floor coverings are functional.

10.4 - COMMENTS: Where visible and accessible, the majority of floor coverings were in satisfactory condition for their age.

Walls and Ceilings

Walls

10.5 - DEFICIENT: There is settlement damage to the wall covering in the main entry that needs repair.



10.6 - DEFERRED: There is moisture damage to the drywall in the upstairs bedroom that you will need to have evaluated by an appropriately qualified specialist for further remarks and recommendations.



Ceilings

10.7 - DEFERRED: There is moisture-like staining in the upstairs bedroom ceiling covering that you will need to have evaluated for mold by an appropriate environmental specialist for further remarks and

recommendations. This is important because some types of mold can be harmful to some people.



10.8 - COMMENTS: The ceiling coverings are functional.

Windows

Windows

10.9 - COMMENTS: All tested windows were found to be functional at the time of the inspection.

Doors

Main Entry

10.10 - COMMENTS: The main entry door is functional.

Exterior

10.11 - COMMENTS: The exterior doors function satisfactorily.

Interior

10.12 - DEFICIENT: The door at the top of the stairs needs adjustment to close correctly.



10.13 - COMMENTS: The interior doors function satisfactorily.

Closets

10.14 - COMMENTS: The closet doors function satisfactorily.

Stairs and Landings

Handrails

10.15 - COMMENTS: The handrailings appear to be functional and secure.

Stairs

10.16 - COMMENTS: The stairs and landing appeared to be in satisfactory condition.

Built-In Appliances

Appliances

10.17 - COMMENTS: The appliances are tested for primary functionality only. Your inspector does not and can not evaluate them for their overall performance or for any secondary features, settings or cycles.

Dishwasher

10.18 - COMMENTS: The Frigidaire dishwasher responded to normal user controls and progresses through all of its cycles in the 'normal' mode.



Garbage Disposal

10.19 - COMMENTS: The garbage disposal responded to normal user controls.

Gas Cook Top

10.20 - COMMENTS: The KitchenAid gas cook top responded to normal user controls.



Electric Oven

10.21 - COMMENTS: The GE electric oven responded to normal user controls.



Microwave

10.22 - COMMENTS: The built-in GE microwave oven responded to normal user controls.



Laundry Provisions

Laundry Provisions

10.23 - DEFERRED: Freestanding laundry appliances were not inspected or tested.

10.24 - COMMENTS: The laundry provisions are located in the bedroom hallway closet.



Washer Drainage

10.25 - COMMENTS: There is a washer drain line present, but the line was not filled or tested and we cannot guarantee that the drain line is functional.



Dryer Venting

10.26 - COMMENTS: Dryer exhaust provisions were satisfactory.



Gas Supply

10.27 - COMMENTS: The gas line and valve for the clothes dryer appeared to be in satisfactory condition. However, the valve was not turned or tested, and should be capped if it not to be used.



Electrical Supply

10.28 - COMMENTS: A 220 volt outlet was provided but was not tested.



Smoke Alarms

Placement

10.29 - COMMENTS: There is a battery powered smoke detector in the master bedroom.

10.30 - COMMENTS: There is a battery powered smoke detector in the bedroom hallway.

10.31 - COMMENTS: There is a battery powered smoke detector at the top of the basement stairs.

Testing

10.32 - DEFERRED: In accordance with home inspection industry standards, we do not test smoke detectors. However, they are an important safety feature that must not be overlooked, and it is important to make sure that there are functional detectors installed at all required locations prior to occupying the premises.

10.33 - DEFERRED: Because it is not unusual for a lengthy period of time to pass between the time the inspection took place and when the home is actually occupied, it is imperative that all smoke detectors, both battery and hardwired, be tested for safe and proper function prior to occupation of the premises.

Ventilation and Exhaust

Bathroom

10.34 - COMMENTS: The bathroom exhaust fans are functional.

Other Components

Doorbells

10.35 - COMMENTS: The doorbell responded audibly to its test button.

Garage

Interior

General Comments

11.1 - COMMENTS: Garages come in all shapes and sizes, and we recommend that you measure the length and width of the garage space(s) to ensure that there is sufficient clearance to accommodate your vehicle(s). Most newer garages are approximately 20 ft. x 20 ft. in diameter or larger.

Windows

11.2 - COMMENTS: All tested garage windows were found to be functional at the time of the inspection.

Walls and Ceiling

11.3 - COMMENTS: The wall coverings appear functional, with typical wear or cosmetic damage commensurate with their age.

11.4 - COMMENTS: The ceiling coverings are functional.

Vehicle Doors

Vehicle Doors

11.5 - COMMENTS: The two sectional garage vehicle doors functioned satisfactorily when tested.

General

Environmental Comments

Pest Control

12.1 - COMMENTS: Your home inspector is not a licensed pest control operator, and is not trained or appropriately qualified to provide you with any information with regards to rodents, pests, and wood destroying insects or organisms, or the possibility of hidden damage or potential health hazards caused by the presence of same. We therefore recommend that you have the residence inspected for these conditions by an appropriately qualified and licensed pest control operator prior to the close of this transaction.

Important Information

Important - Please Read Carefully

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions. If any item or comment is unclear, you should ask the inspector to clarify the findings. It is important that you carefully read ALL of this information upon receipt. This inspection has been performed, and this report prepared, in accordance with State-recognized standards for home inspections. An inspection addresses only those components and conditions that are present, visible, and accessible at the time of the inspection. While there may be other parts, components or systems present, only those items specifically noted as being inspected were inspected. The inspector is not required to move furnishings or stored items. The inspection report may address issues that are code-based or may refer to a particular code; however, this is NOT a code compliance inspection and does NOT verify compliance with manufacturer's installation instructions. The inspection does NOT imply insurability or warrantability of the structure or its components. Although some safety issues may be addressed in this report, this inspection is NOT a safety/code inspection, and the inspector is NOT required to identify all potential hazards. In this report, the inspector will note which systems and components were inspected, and report any deficiencies, safety concerns, maintenance and monitoring requirements, and any items that are deferred.

DEFINITION OF TERMS USED IN REPORT:

DEFICIENT: A system or component marked as deficient is one that did not respond to user controls, was not able to be safely used, was not functioning as intended, or was otherwise defective. These may be items that are incomplete or have imperfections and with further evaluation these items may (or may not) be found to be material defects. Your inspector does NOT prioritize or emphasize the importance of one deficiency over another. General deficiencies include inoperability, material distress, water penetration, damage, deterioration, missing parts, and unsuitable installation.

SAFETY CONCERN: Items or conditions reported as a safety concern may be property or system upgrades that enhance general safety, others may be considered life threatening. Your inspector will NOT prioritize or emphasize the importance of one safety concern over another. For this reason, ALL safety concerns should be evaluated by appropriate specialists and corrected immediately.

MAINTENANCE: A system or component requiring maintenance appears to be functioning as intended, but would benefit from minor repair, maintenance or improvement at this time. General deficiencies include patching, painting, cleaning, or in some instances a system service by an appropriate specialist.

PREVENTIVE: Any improvement to an area, system, component or condition that would help prevent a deficiency from occurring.

MONITOR: An area, condition, system or component that is in need of monitoring appears to be functioning as intended and capable of safe usage in its present condition; however, the inspector's concern stated in the report should be monitored or further evaluated by an appropriate person.

DEFERRED: An area, system, component or condition that is listed as deferred is one that could not be operated or inspected for the reason stated in the report, and will require further evaluation by a licensed and qualified contractor or other professional. These may also be items outside our standard of practice, inaccessible or not functional. Specialist evaluation of deferred items should take place as soon as possible to avoid any unpleasant surprises after title to the property has been transferred.

This property inspection is not an exhaustive inspection of the structure, systems, or components. The inspection may not reveal all deficiencies. A real estate inspection helps to reduce some of the risk involved in purchasing a home, but it cannot eliminate these risks, nor can the inspection anticipate future events or changes in performance due to changes in use or occupancy. It is recommended that you obtain as much information as is available about this property, including any seller's disclosures, previous inspection reports, engineering reports, building/remodeling permits, and reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should also attempt to determine whether repairs, renovation, remodeling, additions, or other such activities have taken place at this property. It is not the inspector's responsibility to confirm that information obtained from these sources is complete or accurate or that this inspection is consistent with the opinions expressed in previous or future reports.

Items identified in the report do not obligate any party to make repairs or take other action, nor is the purchaser required to request that the seller take any action. When a deficiency, safety concern, maintenance or monitoring requirement, or deferred item is reported, it is the client's responsibility to obtain further evaluations and/or cost estimates from qualified service professionals. Any such follow-up should take place prior to the expiration of any time limitations such as option periods. Evaluations by qualified trades- persons may lead to the discovery of additional deficiencies which may involve additional repair costs. Failure to address deficiencies or comments noted in this report may lead to further damage of the structure or systems and add to the original repair costs. The inspector is not required to provide follow-up services to verify that proper repairs have been made, but may choose to do so for an additional fee.

Property conditions can and do change with time and use. Appliances and mechanical devices can fail at any time, plumbing gaskets and seals may crack and leak if the appliance or plumbing fixture is not used often, roof leaks can occur at any time regardless of the apparent condition of the roof, and the performance of the structure and the systems may change due to changes in use or occupancy, effects of weather, etc. These changes or repairs made to the structure after the inspection may render information contained herein obsolete or invalid. This report is provided for the specific benefit of the client named above and is based on observations at the time of the inspection. If you did not hire the inspector yourself, reliance on this report may provide incomplete or outdated information. Repairs, professional opinions or additional inspection reports may affect the meaning of the information in this report. It is recommended that you hire a qualified inspector to perform an inspection to meet your specific needs and to provide you with current information concerning this property.

Table of Contents

Title 46 PROFESSIONAL AND OCCUPATIONAL STANDARDS

Part XL. Home Inspectors

Chapter 1. General Rules.....	1
§101. Adoption of Rules.....	1
§103. Domicile; Meetings; Quorum; Service of Process; Publication.....	1
§105. Officers; Election; Secretary-Treasurer; Chief Operating Officer; Board Staff; Duties.....	1
§107. Meetings.....	1
§109. Definitions.....	2
§111. Licensing.....	2
§113. Qualifications for Licensure and Application.....	2
§115. Licensing Applications; Forms; Terms; Renewals; Inactive Status.....	3
§117. Fees; Submission of Report Fees; Timeliness of Filings.....	3
§119. Education/Training and Testing; Initial Licensure.....	4
§120. Education Providers; Qualifications.....	5
§121. Continuing Education; Instructors.....	7
§122. Military Trained Applicants.....	9
§123. Home Inspection Reports; Consumer Protection.....	9
§125. Home Inspectors Record Keeping; Inspection; Production Retention.....	10
§127. Insurance.....	10
§129. Reciprocity.....	10
§131. Exemptions from Licensure.....	10
§133. Report of Address Changes.....	11
§135. Display of License.....	11
§137. LSBHI Funds; Deposits and Disbursements; Board Members; Reimbursement.....	11
§139. Prohibited Acts: Penalties and Costs.....	12
§141. Cease and Desist Orders; Injunctive Relief.....	12
Chapter 3. Standards of Practice.....	13
§301. Minimum Standards.....	13
§303. Definitions.....	13
§305. Purpose and Scope.....	15
§307. General Limitations.....	15
§309. General Exclusions.....	15
§311. Structural Systems.....	16
§313. Exterior System.....	17
§315. Roofing System.....	17
§317. Plumbing System.....	17
§319. Electrical System.....	18
§321. Air Conditioning and Heating System.....	19
§325. Interior System.....	19
§327. Insulation and Ventilation System.....	19
§329. Built-In Kitchen Appliances.....	20
Chapter 5. Code of Ethics.....	20
§501. Code of Ethics.....	20

Table of Contents

Chapter 7. Disciplinary Actions 21

 §701. Definitions 21

 §703. Complaints..... 21

 §705. Special Investigating Entity 22

 §707. Investigations; Special Investigating Entity; Board Review 22

 §709. Disciplinary Hearing; Procedure 22

 §711. Pre-Hearing Resolution 23

 §713. Hearing Procedure; Decision; Notice; Effective Date; Rehearing 23

Chapter 9. Declaratory Orders..... 23

 §901. Purpose 23

 §903. Declaratory Relief 23

 §905. Applications; Petitions; Parties..... 24

 §907. Governing Law 24

 §909. Hearings; Decisions; Rehearing; Time..... 24

Chapter 11. Judicial Review 24

 §1101. Judicial Review; Venue; Time..... 24

 §1103. Appeals 24

Title 46
PROFESSIONAL AND OCCUPATIONAL STANDARDS
Part XL. Home Inspectors

Chapter 1. General Rules

§101. Adoption of Rules

A. This administrative code (rules of the board) and all revisions and additions to these rules shall be adopted in accordance with R.S. 49:950 et seq., the Administrative Procedure Act.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1474 and R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2738 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1686 (August 2004).

§103. Domicile; Meetings; Quorum; Service of Process; Publication

A. The board shall be domiciled in Baton Rouge, but may meet in other locations as determined by the board. A majority of the board members shall constitute a quorum of the board for all purposes, including the issuance of licenses and the rulemaking and adjudicative functions of the board.

B. The chief operating officer of the board shall be the agent for service of process. The board shall register the name and address of its agent for service of process as required by law.

C. The board shall publish quarterly a bulletin, which shall be the official journal of the board. This bulletin shall contain notice of all applications filed, board agendas, minutes of open meetings, request for declaratory relief, and generally serve as the board's form notice to licensees and the public. All licensees shall receive the bulletin free of charge. Others may subscribe to the bulleting.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1474-1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2738 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 36:2857 (December 2010).

§105. Officers; Election; Secretary-Treasurer; Chief Operating Officer; Board Staff; Duties

A. Officers shall be elected by the board at the last meeting of the preceding year, shall serve a term of one year and may be reelected for additional terms. Officers may be reelected for additional terms. The board shall elect a chairman and a vice chairman.

B. The board shall employ a secretary-treasurer who shall not be a member of the board to serve as the chief operating officer (COO) of the board. The COO shall employ other staff as reasonably necessary with approval of the board, and subject to budgetary limitations. In the

absence of a contrary board pronouncement, the COO shall serve as the board's appointing authority.

1. The COO shall be the custodian of all documents, filings and records of the board, and may issue process in the board's name.

2. The COO shall be responsible for the day to day operations of the board office and shall prepare and submit a budget for the board's consideration and approval.

3. The COO may have other duties and responsibilities as conferred by the board.

4. The board shall fix the COO's compensation.

C. The chairman shall preside at all meetings, approve the agenda and shall be the official custodian of all records.

D. The board shall be represented by the attorney generals office. In lieu of available representation from the attorney general, the board may retain qualified counsel of its choice as according to law and at fees no higher than the schedule provided by the attorney general for special assistant attorneys general. An attorney is qualified if a reasonable portion of their practice and experience is obtained from or devoted to administrative agency practice and procedure or civil litigation. In the event the board needs counsel on a specific area of expertise, an attorney may be retained for that purpose.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2738 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1686 (August 2004), 36:2857 (December 2010).

§107. Meetings

A. All meetings shall be held in accordance with the Louisiana open meetings law. Unless otherwise designated by the board, all meetings shall be held at the board's domicile in Baton Rouge.

B. The place, date and time of quarterly meetings are to be published in the official state journal at the beginning of each calendar year.

C. Special meetings shall be held at least two weeks after notification is given to each board member, unless a decision or action is required by the board within two weeks of the scheduling of a special meeting. In that case, each board member shall receive at least 24-hour's notice. The public shall be provided notice of all special meetings as soon as practicable, but no less than 24-hour's notice. Special meeting agendas are to be posted at the meeting site at least 24 hours prior to the meeting.

PROFESSIONAL AND OCCUPATIONAL STANDARDS

D. Notices of all meetings and agendas shall be provided to all persons requesting notice in the same manner as provided to board members.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1474-1475 and R.S. 42:7.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2739 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 41:919 (May 2015).

§109. Definitions

Applicant—a person who seeks to be examined for licensure by the board.

Board—the Louisiana State Board of Home Inspectors.

Code—the professional and occupational standards of home inspectors promulgated in LAC 46:XL.

Credit Hour—one continuing education course classroom hour, comprising at least 50 minutes of instruction.

Law—the Louisiana Home Inspector Licensing Law, R.S. 37:1471-1489.

License Period—one year, expiring on the last day of the month of issuance of the preceding year.

Licensee—any person who has been issued a license by the board in accordance with the provisions of the law and these rules.

LSBHI—an acronym for the Louisiana State Board of Home Inspectors.

Resale Residential Building—a structure intended to be or that is used as a residence and consists of four or less living units, excluding commercial use space or units, which is not for sale for the first time.

Rules—the body of regulations governing the board's discharge of its duties and responsibilities and prescribing the privileges and obligations of persons desiring to engage in the home inspection business in Louisiana under the Louisiana State Home Inspectors Licensing Law.

Timely Filing—a letter or written communication bearing a United States Post Office mark inscribed with the date a filing or report is due at the board's office. Any report or materials for filing bearing the canceled postal mark received on the next business day following the due date are presumed timely filed. Any report or materials for filing received after that time may be deemed timely filed only if evidenced by a return receipt or proof of mailing bearing the due date.

AUTHORITY NOTE: Promulgated in accordance with R.S.37:1473 and R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2739 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1686 (August 2004), LR 36:2858 (December 2010), LR 41:919 (May 2015).

§111. Licensing

A. Beginning January 1, 2001, no person shall engage in or conduct, or advertise or hold himself out as engaging in or conducting the business of, or acting in the capacity of, a home inspector within the state without first obtaining a license from the board.

B. No license to conduct business as a home inspector shall be issued to a corporation, limited liability company, partnership, firm, or group. The individually licensed inspectors, whether operating a business as a sole proprietorship or working for a company or corporation, shall be ultimately responsible for compliance with these rules, including, but not limited to:

1. payment of all applicable fees;
2. proper retention of records; and
3. all other obligations as prescribed by these rules.

C. Licensing shall be governed by §§113 and 115.

D. All legal persons, business associations or related endeavors whose owners, shareholders, members, or other persons holding a proprietary interest in the endeavor who currently or formerly employ a licensed home inspector or an individual whose activities may be subject to the law or the rules shall permit the inspector or individual to retain copies of all related records of these activities. They shall be provided to the board upon its request.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475, R.S. 37:1477 and R.S. 37:1479.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2740 (December 2000).

§113. Qualifications for Licensure and Application

A. Applicants must have:

1. attained the age of 18 years;
2. successfully completed high school or its equivalent/GED;
3. passed the required training and licensing examinations, unless exempt under §119.C;
4. paid the appropriate fees;
5. submitted an application for licensure on board prescribed forms which shall conform to these rules;
6. proof of insurance as required by these rules; and
7. not had a license revoked or suspended by the home inspector licensing authority of another state.

AUTHORITY NOTE: Promulgated in accordance with R.S.37:1475-1477 and R.S. 37:1479.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2740 (December 2000).

Title 46, Part XL

§115. Licensing Applications; Forms; Terms; Renewals; Inactive Status

A. Initial home inspector license applications are to be made on approved forms supplied by the board. Each applicant shall complete all chapters of the application. The application shall also be notarized and accompanied by two current passport sized photographs of the applicant. The application shall contain the applicant's Social Security number, however, the number shall be deleted or blackened out from any public record.

B. Upon renewal of a license, the licensee shall submit a copy of a completed inspection report form from the previous licensing period. All client information, including name and address, shall be deleted from the form. Reports must comply with §123.

C. Licenses shall be renewed on an annual basis. Licenses shall expire one year after the last day of the month of issuance of the preceding year. Renewal requests shall be made on approved renewal application forms supplied by the board and must be received at least two weeks prior to the expiration date of the current license. Each applicant shall complete all Chapters of the renewal application.

D. Any licensee who fails to timely renew his license may thereafter obtain renewal upon filing a renewal application and upon paying the appropriate renewal and delinquent fees. The period for delinquent renewal of an expired license shall be limited to the 12-month period immediately following the expiration date of the active license. Failure to renew an expired license during such 12-month period shall require the former licensee to pass the board approved licensing examination, pay the appropriate renewal and delinquent fees, file a renewal application, and complete all continuing education requirements accruing during the period of delinquency. Failure to renew an expired license within the 36-month period immediately following the expiration date of the active license shall, in addition to the above requirements, require the licensee to retake and pass 90 hours of classroom education as set forth in the board rules and take the standards of practice and *Code of Ethics* report writing seminar offered by the board or other board approved education provider. Any home inspection performed during an expiration period is considered a violation and shall subject the licensee to disciplinary action by the board.

E. A licensee may hold inactive status by maintaining license renewals and continuing education requirements, but all insurance requirements are waived provided no home inspections are performed.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475-1477 and R.S. 37:1479.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2740 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1687 (August 2004), LR 36:2858 (December 2010), LR 37:2405 (August 2011), LR 41:919 (May 2015).

§117. Fees; Submission of Report Fees; Timeliness of Filings

A. Fees charged by LSBHI are as follows:

1. application for license—\$200;
2. license renewal—\$100;
3. delinquent renewal (for home inspectors only)—\$100;
4. initial qualifying/continuing education provider—\$200;
5. annual renewal for education provider—\$200;
6. filing for additional course offerings—\$50;
7. inspection report—\$5.

B. Each home inspection performed by an inspector under these rules shall be subject to a \$5 state inspection fee per home inspection. This fee is to be made payable to the Louisiana state Board of Home Inspectors and is to be remitted monthly in the following manner.

1. A reporting form, approved by the board, must be filed by the fifteenth day of the month following the inspection. The form shall list the inspections performed and total fees due.

2. Payment must be made by the fifteenth day of each month following the inspection. Payment is considered current if post marked by the fifteenth day. When the fifteenth day of any month falls on a legal holiday, reports are due on the next business day. Reports are timely if they bear a United States Post Office mark or cancellation. Reports bearing the postal mark received on the next business day after that time may be deemed timely filed only if evidenced by a return receipt or proof of mailing bearing the due date.

3. Failure to report and/or pay inspection report fees, if fees are due, can result in suspension of license, fine, or both.

4. The board may inspect any licensee's records to insure compliance with the licensee's obligation to submit reports and remit fees. The failure of a licensee to cooperate with the board's reasonable request for said inspection shall constitute a violation of these rules.

C. The board may charge any additional fee or any additional charge not listed in this schedule as may be provided for under other law or regulation.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475-1477 and R.S. 37:1479.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2740 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 34:1926 (September 2008), LR 36:2858 (December 2010), LR 41:920 (May 2015).

PROFESSIONAL AND OCCUPATIONAL STANDARDS

§119. Education/Training and Testing; Initial Licensure

A. Initial applicants for licensure must pass a board-approved licensing examination covering home inspection methods and techniques, the standards of practice set forth in §301 et seq., and code of ethics set forth in §501.

B. Any person filing an initial application for licensure shall present evidence to the board that he has satisfactorily completed at least 130 hours of required home inspection instruction and training by training providers and instructors approved by the board.

C. The 130 hours of home inspection instruction and training shall consist of the following:

1. 90 hours of home inspection course work approved by the board and taught by a certified pre-licensing education provider as set forth in §120;

2. 30 hours of in-field platform training from a certified infield trainer;

3. 10 hours of instruction and training from a certified in-field trainer, which shall consist of attending 10 live home inspections at a residential structure where a fee is paid and a report is provided to a client.

4. In addition to completion of the 130 hours of home inspection instruction and in-field training, the applicant shall also attend the report writing seminar conducted on behalf of the board or its approved representative and pass the board approved examination of the Standards of Practice and Code of Ethics.

D.1. The 90 hours of course work as set forth in §119.C.1 above, may only include a combination of any of the following methods of instruction:

a. live lectures by a certified home inspector instructor;

b. DVD, CD ROM, videotape, streaming or other electronic means of video lecture, with a certified home inspector instructor available during classroom hours for questioning and discussion;

c. in-classroom or remote demonstration of techniques; or

d. periodic, in-classroom testing.

2. No credit towards the 90 hours of course work shall be given for:

a. in-classroom study;

b. instruction received from an education provider not duly qualified by the board;

c. time spent listening to audiotapes; or

d. classroom time devoted to non-approved course materials.

3. Before the trainee can be certified as having completed the required 90 hours of course work, the trainee must have:

a. attended and completed the 90 hours of course work within 180 days of commencement;

b. passed, with a grade of 70 percent or higher, the final examination and all periodic examinations given by the educational provider; and

c. mailed a completed LHI Application Form and Education Provider Application Form to the board.

E. Before registering for the 90 hours of course work with a certified pre-licensing educational provider, the trainee must first apply with the board. After enrolling with a certified educational provider, the trainee must provide the board with the name of the provider and the commencement date of instruction.

F. Prior to admission to an infield training program, the trainee shall complete the required 90 hours of course work described in §119.A.

G. Infield training shall consist of platform training and live training.

1. Platform training shall consist of attending 30 hours of hands-on training with a certified infield trainer at a residential structure or using residential components or equipment. All systems of a residential structure shall be examined and inspected during platform training. The applicant shall be given one credit hour for each hour of platform training attended. No more than four applicants may be trained at one time during platform training. Platform training shall not be conducted during a live home inspection where an inspection fee is paid and an inspection report is provided to a client.

2. Live training shall consist of attending 10 live home inspections with a certified infield trainer at a resale residential structure where a fee is paid and a report is provided to the client. The applicant shall be given one credit hour for each live inspection attended. No more than two applicants may be trained at a time during a live home inspection. During each inspection, the trainee shall prepare a mock home inspection report in a format approved by the board that conforms to the requirements of the Standards of Practice for each home inspected during live training. The applicant shall retain these reports for three years from the date of completion of training.

H. Upon registering trainees for a 90 hour course, all certified pre-licensing education providers shall:

1. notify the board of the date of the commencement of each 90 hour course of instruction of each trainee;

2. provide the names, addresses, and telephone numbers of all trainees enrolled for that course;

3. keep records of attendance of each trainee enrolled in the pre-licensing course to confirm satisfactory completion of the required 90 hours of instruction;

Title 46, Part XL

4. provide the trainee with an education provider evaluation form approved by the board prior to final testing and completion of the required 90 hours of instruction;

5. provide a final examination and multiple periodic examinations to the trainee covering course contents; and

6. provide a copy of certificates of completion to the board of only those trainees who have successfully completed the full 90 hours of instruction.

I. Certified infield trainers shall:

1. instruct the trainee on how to complete and file the monthly state reporting form;

2. provide the trainee with a copy of the Standards of Practice and Code of Ethics;

3. issue to the trainee a certificate of completion of platform training and/or live training; and

4. maintain for three years a list of all trainees and the dates of training.

J. The board shall adopt and approve a licensing examination, which may be administered by a nationally accepted testing service as determined by the board.

K. The board shall review examination material relative to the adoption and approval of licensing examinations. The board shall have complete authority to enter into confidentiality agreements, which prohibit the public dissemination of information pertaining to review of questions or materials, including any questions or materials certified as proprietary by the person or facility submitting them for evaluation. Any person or testing facility submitting evaluation materials for review, certification, or otherwise, conveys and assigns to the board a right of limited use and license solely for use in the certification process and any related inquiry.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475 and R.S. 37:1485-1487.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2741 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1687 (August 2004), LR 35:1519 (August 2009), LR 36:2858 (December 2010), LR 38:2529 (October 2012), LR 40:1003 (May 2014), LR 41:920 (May 2015).

§120. Education Providers; Qualifications

A.1. A *certified education provider* is defined as any individual or entity certified by the Board to provide home inspector pre-license education, in-field training and/or continuing education courses.

2. A *pre-licensing education* provider is defined as any individual or entity certified by the board to provide pre-licensing education.

3. A *continuing education provider* is defined as any individual or entity certified by the board to provide post license continuing education.

4. An *infield trainer* is defined as any individual certified by the board to provide home inspector infield training.

5. A *home inspector instructor* is defined as any individual certified by the board to provide home inspector instruction for an education provider.

6. A *guest lecturer* is defined as an individual licensed and/or certified in a construction related field, who provides pre-license and/or continuing education instruction for an education provider.

B.1. Certifications issued under this Chapter shall be classified in the following categories:

- a. pre-licensing education providers;
- b. continuing education providers; and
- c. infield trainers.

2. Any individual or entity desiring to conduct business in this state as an education provider, continuing education provider or infield trainer shall file an application for certification with the board.

3. The application shall be in such form and detail as prescribed by the board.

4. The board shall approve or deny an application within 90 calendar days after it is received. Incomplete applications or a request from the board for additional information may be cause for delay beyond 90 calendar days.

5. The board may deny an application of an education provider or its director for certification for any of the following reasons.

a. The applicant has been convicted of forgery, embezzlement, obtaining money under false pretenses, larceny, extortion, conspiracy to defraud, or theft, or has been convicted of a felony or crime involving moral turpitude in any court of competent jurisdiction.

b. An application contains a false statement of material fact.

c. A professional license or certification held by an applicant or its director has been revoked.

6. The board shall issue a certificate and assign a certificate number to approved applicants that shall be included on all forms, documents, reports, and/or correspondence filed with the board.

C. Education provider certificates shall be renewed by December 31 of each year.

1. Failure to renew a certificate by December 31 shall result in the automatic suspension of all courses approved under the certificate. The board shall not accept any pre-license education, in-field training or continuing education courses for credit, if the courses were offered and/or conducted after the expiration of the certificate.

PROFESSIONAL AND OCCUPATIONAL STANDARDS

2. Applications for delinquent renewal of a certificate shall not be accepted by the board after January 31. Failure to renew an expired certificate during the prescribed delinquent period shall result in the forfeiture of renewal rights. Any education provider that becomes ineligible to renew a certificate shall apply as an initial applicant.

D.1. All education providers shall designate a director, whose duty it shall be to ensure that the operations of the education facility and all training locations adhere to the requirements of the Louisiana Home Inspector License Law and the rules and regulations of the board. The director shall be held responsible to the board for any violations thereof.

2. Directors shall coordinate and disseminate information pertaining to amendments in the license law, rules and regulations, or policies and procedures of the board to all staff, instructors, and employees of the education provider.

E.1. The board or its representative may inspect any educational facility used by an education provider at any time during regular business hours.

2. Education providers shall be subject to periodic audits and review, as determined by the board, to ensure that courses and field training provided are conducted in accordance with the provisions set forth in this Chapter and R.S. 37:1471, et seq. This may include the observation and evaluation of classroom activities, course content, instructor proficiency, and/or the audit of reporting/attendance records.

3. If the education provider is found deficient in any part of this Section, the board shall prepare a report specifying the areas of deficiency and deliver it to the education provider within 30 days of completion of the report.

4. Any education provider that receives a report of deficiencies shall correct the deficiencies by the date designated by the board and shall submit a report to the Board that outlines the corrective action.

F.1. Education providers shall maintain accurate and properly indexed records on all students for at least three years after course completion and shall produce those records for inspection upon request of the board. Electronic records shall be maintained in a readily available format that does not prohibit, delay, or otherwise impede inspection.

2. Education providers shall maintain the following records on each student:

- a. complete name and address;
- b. total educational hours taken and course title;
- c. dates of attendance;
- d. test scores indications; and
- e. a copy of the student contract.

3. Education providers shall provide any student who requests it with a duplicate copy of his/her course completion records.

G.1. Each pre-licensing education provider shall enter into a written student contract with each student that shall clearly set forth the tuition and fees charged by the provider for the specific course of instruction and the provider's refund policy.

2. A copy of the contract, signed by the director of the education provider, shall be provided to the student immediately after both parties sign the contract.

3. Any additional fees charged for supplies, materials, or required books shall be clearly itemized in the contract and such supplies, materials, or books shall become the property of the student upon payment.

4. All other educational providers shall provide the student with documentation, either electronically or otherwise, which clearly sets forth the title, date, location and cost of the course and the number of continuing education or field training hours that are approved by the board for the course.

H. The board shall be notified within 30 calendar days of any change in the address and/or telephone number of education provider and/or director of any education provider.

I.1. Advertising by certified education providers shall be clear, concise and accurate and shall contain the certificate number of the provider. All advertisements shall be in the name of the education provider as certified by the board. Advertising by education providers shall not be false or misleading.

2. The board may require an education provider to furnish proof of any advertising claims. The board may order the retraction of advertising that violates the provisions of this Section. Such retractions shall be published in the same manner as the original claim and be paid for by the education provider.

3. Education providers shall not guarantee the passing of the home inspector licensing examination.

J.1. In order to qualify as a pre-licensing education provider, an applicant shall:

- a. pay the pre-licensing education provider fee;
 - b. provide a syllabus and a course list to the board;
 - c. agree, in writing, to defend, indemnify and hold the board harmless against any claim or suit alleging negligent or intentional acts or omissions of the education provider in its training, or otherwise;
 - d. remain current on all renewal and other fees;
 - e. employ only certified home inspector instructors;
- and
- f. be approved by the board.

2. In order to qualify as a certified home inspector instructor of a pre-licensing education provider, a person must:

Title 46, Part XL

- a. have been actively engaged in the performance of home inspections for the three years prior to certification;
 - b. have been an actively engaged, Louisiana licensed home inspector for the three years prior to certification;
 - c. provide evidence that he has performed at least 500 home inspections; or
 - d. be licensed in the field of the subject matter of the particular course instructed.
3. In order to qualify as an infield trainer, an applicant shall:
- a. be a LSBHI licensed home inspector for at least three years;
 - b. pay the required infield trainer fee(s);
 - c. be current on all other fees;
 - d. be current on all continuing education hours;
 - e. agree, in writing, to defend, indemnify and hold the board harmless against any claim or suit alleging negligent or intentional acts or omissions of the education provider in its training, or otherwise; and
 - f. be approved by the board.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475 and R.S. 37:1485-1487.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home inspectors, LR 30:1687 (August 2004), amended by the Office of the Governor, Board of Home Inspectors, LR 31:2011 (August 2005), LR 35:1520 (August 2009), LR 36:2859 (December 2010), LR 38:2530 (October 2012), LR 41:920 (May 2015).

§121. Continuing Education; Instructors

A. As a condition of license renewal, an inspector must certify completion of at least 20 hours of continuing education during the previous licensing period, in courses approved by the board. No more than 10 hours of continuing education credit may be carried over into the following year. Board-approved continuing education instructors may be given continuing education credit for course preparation and other activities as set forth in Paragraph F.3, below.

B. Continuing Education Courses

1. The same continuing education course may be taken only once for continuing education credit during any two year period, unless otherwise approved by the board.
2. For each license period the board may specify mandatory subject matter for one course, such course to be not less than two or more than four credit hours. The remaining courses shall be elective courses covering subject matter to be chosen by the licensee and meeting all other criteria specified in this Chapter.
3. Each course shall last at least one hour and comprise of at least one credit hour.
4. In order to receive credit for completing a continuing education course, a licensee must attend at least

90 percent of the scheduled hours of the course, regardless of the length of the course.

5. The board may approve only up to two hours of credit per licensing period for courses dealing with the construction industry, but outside the scope of the standards of practice.

6. The board may approve up to four hours of credit per licensing period for attending a quarterly or special board meeting or for serving on a committee appointed by the board and up to three hours of credit per appointment and six hours per licensing period for acting as a special investigating entity as described in §707.

7. The board may approve up to two hours of credit per licensing period for each class taken which is taught by a non approved instructor and only upon approval of the chief operating officer prior to the LHI's participation in the course.

8. The board may approve up to eight hours of continuing education credit per licensing period for online and/or streaming video courses.

9. The board may approve up to eight hours of continuing education credit per licensing period for any combination of online courses, streaming video courses, courses given by an unapproved instructor and courses which are outside the scope of the standards of practice.

10. Continuing education credit cannot be received by attending classes designated for pre-license education instruction as set forth in §119.C.1.

11. Continuing education courses must be taught by continuing education providers who meet the criteria set forth in §121.F.1. Qualified guest lecturers may teach courses on behalf of continuing education provider instructors. Last minute guest lecturers may be substituted upon approval by the chief operating officer. The continuing education provider shall be responsible for confirming the qualifications of the guest lecturer.

C.1. The board may approve online, streaming video, and other means of electronic delivery of continuing education courses. Courses taught by online education providers must be certified by the Distance Education Training Council, the International Distance Education Certification Center or the Louisiana Board of Regents and such—certification must be submitted with the education provider's application.

2. All online, streaming video and other electronic delivery courses must be within the scope of the standards of practice.

3. All online, streaming video and other electronic delivery continuing education instructors must meet all continuing education instructor requirements, unless exempt under Paragraph F.2.

4. Streaming video courses must be live and interactive, with the ability for the LHI to communicate immediately with the instructor and ask questions. The

PROFESSIONAL AND OCCUPATIONAL STANDARDS

instructor must have the ability to immediately verify that the LHI's presence and participation in the course. If the instructor cannot verify the LHI's presence and participation, the instructor must dismiss the LHI from the course. No credit will be given for the entire course if the LHI is dismissed.

D.1. The board shall deny continuing education credit claimed by a licensee, and shall withdraw continuing education credit previously awarded by the Board to a licensee if:

- a. the licensee provided incorrect or incomplete information to the board concerning continuing education or compliance with this Section;
- b. the licensee was mistakenly awarded continuing education credit because of an administrative error; or
- c. the licensee failed to comply with the attendance requirement established by Paragraph C of this Section.

2. When continuing education credit is denied or withdrawn by the board under Subsection D of this Section, the licensee remains responsible for satisfying the continuing education requirement. Any license may be suspended until proof of compliance is submitted.

E. It is the duty of every licensee to provide proof of compliance with continuing education requirements on a timely basis. In order to receive credit from the board for completion of continuing education courses under this Section, proof of compliance must be submitted on forms approved by the board and prepared by board-approved continuing education providers.

F.1. In order to qualify as a continuing education provider instructor, an applicant shall:

- a. pay the required continuing education provider fee(s);
- b. be a licensed home inspector from a state requiring licensure for at least three years;
- c. provide evidence that he has completed 300 inspections;
- d. not have been found guilty of violating these rules or the Home Inspector Licensing Law within the five years prior to his application; and
- e. be approved by the board.

2. Professional trade organizations, accredited technical schools and colleges and certain industry companies may be approved by the board on a case by case basis as a continuing education provider without meeting the requirements set forth in Paragraph F.1 above. However, these entities must submit a completed continuing education instructor application, pay the requisite fee and meet all other requirements set forth in these rules.

3. A licensee, who is also a board-approved continuing education instructor, may qualify to receive up to 10 hours of continuing education requirements per licensing period by presenting satisfactory evidence to the board of

participation, other than as a student, in educational processes and programs in home inspection practices or techniques, including but not limited to teaching, program development, and preparation of textbooks, monographs, articles, or other instructional material subject to approval of the board.

4.a. All continuing education providers must submit the following to the chief operating officer for approval at least 10 days prior to instruction:

- i. a syllabus of any course to be taught by that continuing education provider;
- ii. the requested number of continuing education credit hours for each course;
- iii. the name and qualifications of the guest lecturer teaching on his or its behalf, if applicable; and
- iv. the name and qualifications of any guest lecturer teaching on his behalf or, in the event a last minute guest lecturer is substituted, the name and qualifications of the guest lecturer are to be submitted within 10 days after the course is given.

b. The chief operating officer, with direction from the continuing education committee chairman, will determine: the number of hours credit to be given for the continuing education course submitted; whether the course is within the scope of the standards of practice; whether a guest lecturer is approved; and whether the course is approved. Once approved, the provider may teach any approved courses at his discretion.

5. All continuing education providers shall provide sign-in sheets, whether electronic or otherwise, for LHIs to complete upon entering a class, joining a streaming lecture or participating online. At the end of each class, the instructor shall provide the LHI with a certificate of completion. Sign in sheets and certificates of completion shall include the date and time of the course, the number of hours of credit assigned to each course by the board and the name of the instructor teaching the course or courses. The continuing education provider shall forward all sign-in sheets to the board immediately upon request by the board.

6. The names and contact information for all approved continuing education providers will be posted on the board's official website. At the request of a provider, the board will also post announcements of continuing education classes on its website upon written notice by the provider 30 days prior to the class.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1477 and R.S. 37:1479-1480.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2742 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 36:2860 (December 2010), LR 37:2405 (August 2011), LR 38:2531 (October 2012), LR 40:1003 (May 2014).

Title 46, Part XL

§122. Military Trained Applicants

A. Pursuant to R.S. 9:3650 the LSBHI shall issue a license to a military-trained applicant to allow the applicant to lawfully practice home inspection in this state if, upon application to the board, the applicant satisfies all of the following conditions:

1. has completed a military program of training, been awarded a military occupational specialty, and performed in that specialty at a level that is substantially equivalent to or exceeds the requirements for licensure under these rules;
2. has been actively engaged in the practice of home inspection; and
3. has not been disciplined in any jurisdiction for an act that would have constituted grounds for refusal, suspension, or revocation of a license to practice home inspection in this state at the time the act was committed.

B. Notwithstanding any other provision of law, the LSBHI shall issue a license to a military-trained applicant to allow the applicant to lawfully conduct home inspections in this state if, upon application to the board, the applicant holds a current license, certification, or registration from another jurisdiction and that jurisdiction's requirements for licensure are substantially equivalent to or exceed the requirements for licensure under these rules.

C. Notwithstanding any other provision of law, the board shall issue a license to a military spouse to allow the military spouse to lawfully conduct home inspections in this state, if, upon application to the board, the military spouse satisfies all of the following conditions:

1. holds a current license from another state and that jurisdiction's requirements for licensure are substantially equivalent to or exceed the requirements for licensure in this state;
2. can demonstrate competency in the occupation through methods as determined by the board, such as having completed continuing education units or having had recent experience;
3. has not been disciplined in any jurisdiction for an act that would have constituted grounds for refusal, suspension, or revocation of a license to practice home inspection in this state at the time the act was committed;
4. is in good standing and has not been disciplined by the agency that issued the license, certification, or permit in another jurisdiction.

D. In order to obtain a license to practice home inspection in this state, the applicant must make application to the board and provide official evidence that the applicant meets the qualifications set forth in Subsections A or B, above.

E. The board shall issue a temporary practice permit to a military-trained applicant or military spouse licensed in another jurisdiction while the military-trained applicant or military spouse is satisfying the requirements for licensure under the provisions of this Section, if that jurisdiction has

licensure standards substantially equivalent to the standards for licensure of the board in this state. The military-trained applicant or military spouse may practice under the temporary permit until a license is granted or until a notice to deny a license is issued in accordance with rules that shall be promulgated by the board.

F. In order to obtain a temporary practice permit, the applicant must make application to the board and provide:

1. a certified copy of the applicant's license issued by another jurisdiction;
2. evidence that the applicant is in good standing and has not been disciplined by the agency that issued the license in another jurisdiction;
3. evidence that the applicant has not been disciplined in any jurisdiction for an act that would have constituted grounds for refusal, suspension, or revocation of a license to practice home inspection in this state at the time the act was committed.

G. An individual possessing a temporary practice permit under the provisions of this Section shall receive priority processing of their application for license in accordance with these rules.

H. Nothing in this Section shall be construed to prohibit a military-trained applicant or military spouse from proceeding under the existing licensure requirements established by the board.

I. The provisions of this Section shall not apply to any applicant receiving a dishonorable discharge or a military spouse whose spouse received a dishonorable discharge.

J. The provisions of this Section shall not apply to a license issued and regulated under the authority of the judicial branch of government.

AUTHORITY NOTE: Promulgated in accordance with Act 276 of the 2012 Legislative Session, R.S. 37:3650 and R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Office of the Governor, Board of Home Inspectors, LR 40:1003 (May 2014).

§123. Home Inspection Reports; Consumer Protection

A. All home inspection reports shall comply with all requirements as set forth in the standards of practice, these rules and the home inspector licensing law.

B. A copy of the Standards of Practice and Code of Ethics of Home Inspectors shall be provided to every client or his authorized agent, before services are rendered. When this is not practical, copies shall be attached to every completed home inspection report.

C. The board may review any home inspection report and require any change(s) as necessary to comply with Subsections A and B above.

D. Refusal to comply with this Section shall constitute cause for disciplinary action resulting in license revocation, suspension, and/or fine.

PROFESSIONAL AND OCCUPATIONAL STANDARDS

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475-1477 and R.S. 37:1479-1480.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2742 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 41:920 (May 2015).

§125. Home Inspectors Record Keeping; Inspection; Production Retention

A. It shall be the responsibility of the licensed home inspector to maintain adequate records at all times in compliance with the provisions of the board's rules.

B. Records shall be made available, upon reasonable request, to the board's representatives during normal business hours. Such request shall be made in writing on board stationery. The failure of a licensee to maintain adequate records or the failure to furnish copies of such records within 72 hours receipt of a written request by the board shall constitute a violation of this rule.

C. Records shall be kept for three years from the day the inspection report was provided to the client. Any report questioned by the board or any legal entity shall be retained for a period of five years from the date the inquiry was received by the licensee.

D. To facilitate compliance with record keeping requirements of this Section, copies of all home inspection reports performed by a licensee shall be provided to the licensee upon any separation from employment.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2742 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 36:2860 (December 2010), LR 41:920 (May 2015).

§127. Insurance

A. All active, licensed home inspectors shall carry errors and omissions insurance as well as general liability insurance.

1. The LSBHI will establish and/or approve an association or associations for the purposes of availing its licensees to the benefits of group insurance rates. The board shall establish the terms and conditions of coverage, including but not limited to the permissible deductibles and permissible exemptions. Licensees shall have the option of obtaining insurance independently of the approved association or associations that complies with the coverage requirements established by the board.

2. Each licensee shall be notified of the required terms and conditions of coverage for the annual policy at least 30 days prior to the annual renewal date. If the required terms and conditions have not been modified from the previous year's policy, the terms and conditions for the previous year shall apply and the licensee shall not be so notified.

B. Each licensee who chooses not to participate in the group insurance association approved by the board shall file

with the board a certificate of coverage showing compliance with the required terms and conditions of insurance coverage by the inspectors annual license renewal date. The certificate, notice of cancellation, renewal or suspension shall be provided to the board directly by the insurance company.

C. Insurance coverage requirements are as follows:

1. errors and omissions insurance:
 - a. minimum coverage \$300,000 per year;
 - b. maximum deductible \$5,000;
2. general liability insurance:
 - a. minimum coverage \$300,000 per year;
 - b. maximum deductible \$5,000.

D. Every licensee shall provide to his clients or the board's representatives proof of all insurance in force upon request.

E. Upon cancellation of any insurance where a gap in coverage may occur, the licensee shall immediately inform the board. When replacement coverage is obtained, evidence shall be immediately transmitted to the board.

F. Failure to maintain insurance is grounds for license revocation, non-renewal or other disciplinary action.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475, R.S. 37:1477 and R.S. 37:1485.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home inspectors, LR 26:2743 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1688 (August 2004), LR 41:921 (May 2015).

§129. Reciprocity

A. If an applicant is licensed as a home inspector in another state in which laws, rules and testing standards are similar to, but in no case less stringent than, those of the LSBHI, and the applicant is in good standing with that licensing authority, then that state's license may be accepted as evidence of the applicant's experience and training. However, the applicant shall have satisfactorily completed an examination from a testing agency approved by the board, and shall pay all applicable fees as well as comply with the Louisiana Home Inspector Licensing Law and LSBHI administrative code. Applicants seeking reciprocity shall certify under oath that they are in good standing in any state where a license is held. The board may make inquiries of the licensing authority concerning the applicant and respond to similar requests from other licensing authorities.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475 and R.S. 37:1484.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2743 (December 2000).

§131. Exemptions from Licensure

A. Certain individuals, when acting within the scope of their profession or license, are exempt from licensure

Title 46, Part XL

requirements when performing inspections within their licensed profession or trade. Those individuals are:

1. persons licensed by the state as professional engineers when acting within the scope of their license;
2. persons licensed by the state as architects when acting within the scope of their license;
3. persons licensed by the state or any political subdivision as electricians when acting within the scope of their license;
4. persons licensed by the state or any political subdivision as plumbers when acting within the scope of their license;
5. persons licensed by the state or any political subdivision as heating and air conditioning technicians when acting within the scope of their license;
6. persons licensed by the state as real estate brokers or real estate sales persons when acting within the scope of their license;
7. persons licensed by the state as real estate appraisers, certified general appraisers, or residential real estate appraisers when acting within the scope of their license;
8. persons licensed by the state as pest control operators when acting within the scope of their license;
9. persons regulated by the state as insurance adjusters when acting within the scope of their profession;
10. persons who are employed as code enforcement officials by the state or any political subdivision when acting within the scope of their employment by such governmental entity;
11. persons licensed by the state or any political subdivision as contractors when acting within the scope of their license;
12. persons certified by the state or any political subdivision as certified energy raters when acting within the scope of their certification;
13. persons who perform warranty evaluations of components, systems, or appliances within resale residential buildings for the purpose of issuance of a home warranty agreement, provided that the warranty evaluation report includes a statement that the warranty evaluation performed is not a home inspection and does not meet the standards of a home inspection under Louisiana law. No home warranty company shall refer to a warranty evaluation as a home inspection in any written materials provided by the warranty company.

B. The board may consider and adopt additional exemptions by rule reasonably necessary to clarify and implement the exemptions in the law.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475 and R.S. 37:1483.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2743 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1688 (August 2004).

§133. Report of Address Changes

A. Every licensee shall report any change in office address, residence address, office phone, and residence phone to the board, in writing, within 15 days of such change. The board shall acknowledge any change, in writing, and shall update all records accordingly.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2744 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 41:921 (May 2015).

§135. Display of License

A. Home inspectors shall be issued both a picture I.D. license and a license certificate.

B. The inspector is to have on their person the picture I.D. license when performing inspections. The picture I.D. license shall be produced upon request of interested parties when conducting an inspection.

C. A license certificate shall be displayed at the licensee's place of business. If the licensee operates from home, it is to be readily accessible.

D. All correspondence, inspection reports and advertisements shall identify the licensee with the term *licensed home inspector* along with the license number of the inspector.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2744 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 41:921 (May 2015).

§137. LSBHI Funds; Deposits and Disbursements; Board Members; Reimbursement

A. All board funds received shall be paid to the Louisiana State Board of Home Inspectors through its secretary-treasurer and deposited to the board's operating account established for that purpose. Disbursements made by board shall be signed by the chairman and the secretary-treasurer. In absence of the chairman or the secretary-treasurer, the vice chairman may sign all documents with the remaining authorized signatory.

B. All fees and moneys received by the board shall be used solely to effectuate the provisions of the law and these rules. Such use may include, but is not limited to expenditures necessary for office fixtures, equipment and supplies and all other charges necessary to conduct the business of the board.

C. No board member shall receive a per diem but shall be reimbursed for actual expenses incurred when attending a meeting of the board or any of its committees and for the

PROFESSIONAL AND OCCUPATIONAL STANDARDS

time spent on behalf of the board on official business not to exceed 10 days in any one month. Each board member shall be reimbursed upon approval of the board as evidenced by voucher for all necessary travel and incidental expenses incurred in carrying out the provisions of the rules of the board. No reimbursement, other than for lawful travel and mileage shall be allowed for attending any regular or special board meetings or for board related activities outside Louisiana. Reimbursement for time spent may be allowed if the board member is engaged in board business in Louisiana for the following, non-exclusive activities: participation as an appointed member of a special investigating entity; inspecting records of persons subject to the law and these rules; and reviewing and processing applications for licensure unconnected with preparation for a board meeting.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1474-1475, and R.S. 37:1489.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2744 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 41:921 (May 2015).

§139. Prohibited Acts: Penalties and Costs

A. The board may suspend or revoke any license, or censure, fine, or impose probationary or other restrictions on any licensee for good cause shown which shall include but not be limited to the following:

1. being convicted of a felony or the entering of a plea of guilty or nolo contendere to a felony charge under the laws of the United States or any other state;
2. deceit or misrepresentation in obtaining a license;
3. providing false testimony before the board;
4. attempting to deceive or defraud the public;
5. professional incompetence or gross negligence;
6. rendering, submitting, subscribing, or verifying false, deceptive, misleading, or unfounded opinions or reports;
7. violating any rule or regulation adopted by the board or any provision of these rules or the law;
8. aiding or abetting a person to evade the provisions of this Chapter or knowingly combining or conspiring with an unlicensed person with the intent to evade the provisions of these rules or the law;
9. violating any Standard of Conduct adopted by the board;
10. engaging in conduct or advertising or holding oneself out as engaging in or conducting the business or acting in the capacity of a home inspector without possessing a valid license;
11. falsely representing oneself as being the holder of a valid license by using the title "licensed home inspector" or any title, designation, or abbreviation deceptively similar or likely to create the impression that such person is licensed.

B. The board may fine any applicant or any member of the public for good cause shown, for activities which include, but are not limited to, the following:

1. aiding or abetting a person to evade the provisions of this Chapter or knowingly conspiring with any licensed or unlicensed person with the intent to evade the provisions of this Chapter;
2. engaging in conduct or advertising or holding oneself out as engaging in or conducting the business or acting in the capacity of a home inspector without possessing a valid license;
3. falsely representing oneself as being the holder of a valid license by using the title "licensed home inspector" or any title, designation, or abbreviation deceptively similar or likely to create the impression that such person is licensed.

C. Violators of any of the provisions of these rules or the law may be fined by the board in an amount not to exceed \$1,000 per each separate violation.

D. Revocation of a license as a result of disciplinary action by the board may prohibit the re-issuance of a license to such licensee for a period of up to one year from the date of revocation. No license may be granted, renewed or re-issued until any and all fines have been paid. The license of an applicant whose license has been revoked may be reissued by the board upon the successful completion by the applicant of the required examination and upon competent evidence of completion of 20 hours of continuing education as prescribed by the board. A licensee on probation may have his license reinstated upon certification by the board that the licensee is in compliance with the terms of his probation.

E. The board, as a probationary condition or as a condition of a revocation or suspension, may require a licensee to pay all costs of the board proceedings, including but not limited to those expenses related to the services of investigators, stenographers, and attorneys, and any court, agency or board costs.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475 and R.S. 37:1486-1487.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2744 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1688 (August 2004), LR 41:921 (May 2015).

§141. Cease and Desist Orders; Injunctive Relief

A. In addition to or in lieu of the criminal penalties and administrative sanctions provided for in the law and these rules, the board may issue an order to any person engaged in any activity, conduct or practice constituting a violation of any provision of these rules to cease and desist from such activity, conduct or practice. Such order shall be issued in the name of the state and under the official seal of the board.

B. If the person directed by cease and desist order does not cease and desist the prohibited activity, conduct, or practice within two days of service of such order by certified mail, the board may seek a writ of injunction in any court of

Title 46, Part XL

competent jurisdiction and proper venue enjoining such person from engaging in the activity, conduct or practice, and recovery of all related costs of the type described in §139.

C. Upon proper showing of the board that such person or firm has engaged in any activity, conduct or practice prohibited by this Chapter, the court shall issue a temporary restraining order restraining the person or firm from engaging in the unlawful activity, conduct or practice, pending hearing on a preliminary injunction. A permanent injunction shall issue after hearing commanding the cessation of the unlawful activity, conduct or practice complained of, all without the necessity of the board having to give bond as usually required in such cases. A temporary restraining order, preliminary injunction or permanent injunction issued enjoining such person or firm shall not be subject to being released upon bond.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1488.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2745 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1689 (August 2004), LR 41:921 (May 2015).

Chapter 3. Standards of Practice

§301. Minimum Standards

A. This Chapter sets forth the minimum Standards of Practice required of licensed home inspectors.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2745 (December 2000).

§303. Definitions

A. The definitions in §109 of this Part are incorporated into this Chapter by reference. The following definitions apply to this Chapter.

Alarm System—warning devices, whether installed or free standing, including but not limited to, carbon monoxide detectors, flue gas and other spillage detectors, security equipment, ejector pumps and smoke alarms.

Automatic Safety Control—devices designed and installed to protect systems and components from unsafe conditions.

Cooling System—a central system that uses ducts to distribute cooled air to more than one room or uses pipes to distribute chilled water to heat exchangers in more than one room, which system is not plugged into an electrical convenience outlet.

Client—the person with whom a licensed home inspector contracts to perform a home inspection, whether individually or through that person's agent.

Component—a readily accessible and observable aspect of a system, such as a floor or wall, but not individual pieces

such as boards or nails or where many similar pieces make up a component.

Cross Connection—any physical connection or arrangement between potable water and any source of contamination.

Dangerous or Adverse Situations—situations that pose a threat of injury to the inspector, or those situations that require the use of special protective clothing or safety equipment.

Describe—to report, in writing, a system or component by its type, or other observed characteristics, to distinguish it from other systems or components.

Dismantle—to take apart or remove any component, device or piece of equipment that is bolted, screwed, or fastened by other means that would not be taken apart by a homeowner in the course of normal household maintenance.

Enter—to go into an area to observe all visible components.

Functional Drainage—a drain which empties in a reasonable amount of time and does not overflow when another fixture is drained simultaneously.

Functional Flow—a reasonable flow at the highest fixture in a dwelling when another fixture is operated simultaneously.

Functioning—performing as expected and in accordance with its intended design and purpose.

Further Evaluation—examination and analysis by a qualified professional or service technician whose services and qualifications exceed those possessed by a home inspector.

Heating System—a central system that uses ducts to distribute heated air to more than one room which system is not plugged into an electrical convenience outlet.

Home Inspection—the process by which a Home Inspector visually examines the readily accessible systems and components of a home and describes those systems and components in accordance with the Standards of Practice.

Home Inspection Report—a written evaluation of two or more of the following systems of a resale residential building:

- a. electrical system;
- b. exterior system;
- c. interior system;
- d. heating and cooling systems;
- e. plumbing system;
- f. roofing system;
- g. structural system;
- h. insulation and ventilation system;

PROFESSIONAL AND OCCUPATIONAL STANDARDS

- i. appliance system; or
- j. any other related residential housing system as defined in the standards of practice prescribed by the board.

Home Inspector—any person who, in accordance with the provisions of these rules, holds himself out to the general public and engages in the business of performing home inspections on resale residential buildings for compensation and who examines any component of a building, through visual means and through normal user controls, without the use of mathematical sciences.

Inaccessible—unable to open with the use of Standard Inspection Tools or hidden from visual inspection by furniture, stored items, wall or floor coverings or other obstructions.

Inspect—to examine readily accessible systems and components of a building in accordance with the Standards of Practice, using normal operating controls and opening readily openable access panels.

Installed—attached such that removal requires tools.

LHI—an acronym for Licensed Home Inspector.

Method of Access—a means by which the inspector gains entry, ingress and/or a visual advantage.

Normal Operating Controls—devices such as thermostats, switches, or valves intended to be operated by the homeowner.

Normal Operating Cycle—the standard period during which a system or component operates by the use of Normal Operating Controls

Observe—the act of making a visual examination.

On-Site Water Supply Quality—water quality based on the bacterial, chemical, mineral and solids contents of the water.

On-Site Water Supply Quantity—water quantity based on the rate of flow of water.

Operate—to cause systems or equipment to function.

Recreational Facilities—spas, saunas steam baths, swimming pools, tennis courts, and exercise, entertainment, athletic, playground or other equipment and associated accessories.

Readily Accessible—available for visual inspection without requiring the moving of personal property, the dismantling, disconnecting, unplugging or destroying of equipment, or any action which may involve a risk to persons or property.

Readily Openable Access Panel—a panel provided for homeowner inspection and maintenance that is within normal reach, can be removed by one person, is not sealed in place and is not blocked by stored items, furniture, or building components.

Representative Number—for multiple identical interior components such as windows and electrical outlets - one such component per room.

Roof Drainage Components—gutters, downspouts, leaders, splash blocks, scuppers, and similar components used to carry water off a roof and away from a building.

Shut Down—a state in which a system or component cannot be operated by normal user controls.

Significantly Deficient—a condition that, in the inspector's professional opinion, adversely and materially affects the performance of a system or component.

Solid Fuel Heating Device—any wood, coal, or other similar organic fuel burning device, including but not limited to fireplaces whether masonry or factory built, fireplace inserts and stoves, wood stoves central furnaces, and combinations of these devices.

Specialized Tools—diagnostic devices and other equipment, including but not limited to, thermal imaging devices, gas leak detection equipment, environmental testing equipment, elevation determination devices and ladders capable of reaching surfaces over one story above the ground.

Standard Inspection Tools—a flashlight, outlet tester, ladder and appropriate screwdriver.

Structural Component—a component that supports non-variable forces or weights (dead loads) and variable forces or weights (live loads).

System—a combination of interactive or interdependent components assembled to carry out one or more functions.

Technically Exhaustive—an inspection involving the extensive use of measurements, instruments, testing, calculations, or other means used to develop scientific or engineering findings, conclusions, and recommendations.

Under Floor Crawl Space—the area within the confines of the foundation between the ground and the underside of the lowest floor structural component.

Unsafe—a condition of a readily accessible, installed system or component which, in the opinion of the inspector, is judged to be a significant risk of personal injury or property damage during normal use or under the circumstances.

Visually Observable Evidence of Suspected Mold Growth—visually observable discoloration of the interior components within the climate controlled living space apparently occurring from moisture that may be indicative of mold or microbial growth which is visually observable, without employing moisture, environmental or other testing methods.

Wiring Methods—manner or general type of electrical conductors or wires installed in the structure such as non-metallic sheath cable, armored cable, knob and tube, etc.

Title 46, Part XL

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2745 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1689 (August 2004), LR 36:2861 (December 2010), LR 38:2532 (October 2012), LR 41:922 (May 2015), LR 41:1487 (August 2015).

§305. Purpose and Scope

A. The purpose of these Standards of Practice is to establish a minimum and uniform standard for Louisiana state licensed home inspectors. Home inspections performed pursuant to these Standards of Practice are intended to provide the client with information regarding the condition of the systems and components of the home as observed at the time of inspection.

B. Home inspectors shall:

1. provide the client with a written pre-inspection contract, whenever possible, which shall:

a. state that the home inspection is to be done in accordance with the Standards of Practice of the Louisiana State Board of Home Inspectors;

b. describe what inspection services will be provided and their cost;

c. state that the inspection is limited to only those systems or components agreed upon by the client and the inspector; and

d. contain copies of the Standards of Practice and Code of Ethics;

2. inspect readily accessible installed systems and components listed in this Chapter and/or as contractually agreed upon;

3. submit a written report to the client within five days of the inspection which shall:

a. describe those systems specified to be described in §§311-329, and/or as contractually agreed upon;

b. state which systems designated for inspection in this Section have been inspected, and state any systems or components designated for inspection that were not inspected, and the reason for not inspecting;

c. state any systems or components so inspected that, in the professional opinion of the inspector, are significantly deficient, unsafe or non-functioning; and

d. state the name, license number, and contain the signature of the person conducting the inspection.

C. This Chapter does not limit home inspectors from:

1. reporting observations and conditions or rendering opinions of items in addition to those required in Subsection B of this rule;

2. excluding systems and components from the inspection, if requested by the client and so stated in the written contract;

3. inspecting systems and components in addition to those required by these Standards of Practice; or

4. specifying needed repairs, provided that the inspector is appropriately qualified to make such recommendation.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2746 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1690 (August 2004), LR 38:2532 (October 2012).

§307. General Limitations

A. Home inspections done in accordance with this Chapter are visual and are not technically exhaustive.

B. This Chapter applies only to residential resale buildings.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2746 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 41:922 (May 2015).

§309. General Exclusions

A. Home inspectors are not required to inspect or report on:

1. life expectancy of any component or system;
2. the causes of any condition or deficiency;
3. the methods, materials, and costs of corrections;
4. the suitability of the property for any specialized use;

5. compliance or non-compliance with codes, ordinances, statutes, regulatory requirements, special utility, insurance or restrictions;

6. solicit to perform repair services on any system or component of the home which the inspector noted as significantly deficient, non-functioning or unsafe in his home inspection report for a period of one year from the date of the inspection;

7. the presence or absence of any suspected or actual adverse environmental condition or hazardous substance, including but not limited to asbestos, radon lead, mold, contaminated drywall or building components, carcinogens, noise, or contaminants, whether in the building or in soil, water, or air; however, if during the course of inspecting the systems and components of the building in accordance with the law and these rules, the home inspector discovers visually observable evidence of suspected mold or microbial growth, he shall report it;

8. decorative or cosmetic items, underground items, or items not permanently installed;

9. hidden, concealed or latent defects;

PROFESSIONAL AND OCCUPATIONAL STANDARDS

10. items not visible for inspection including the condition of systems or components which are not readily accessible; or

11. future conditions, including but not limited to, the likelihood of failure or the expected life of systems and components.

B. Home inspectors are not required to:

1. offer warranties or guarantees of any kind;
 2. calculate or determine the strength, adequacy, or efficiency of any system or component;
 3. enter the under-floor crawl spaces, attics, or any area which, in the opinion of the home inspector, is not readily accessible;
 4. operate any system or component that is shut down or otherwise inoperable;
 5. operate any system or component that does not respond to normal operating controls;
 6. disturb or move insulation, personal items, panels, furniture, equipment, soil, snow, ice, plant life, debris or other items that may obstruct access or visibility;
 7. determine the effectiveness of any system installed to control or remove suspected hazardous substances;
 8. project operating costs of components;
 9. evaluate acoustical characteristics of any system or component;
 10. inspect special equipment or accessories that are not listed as components to be inspected in this Chapter;
 11. operate shut-off valves;
 12. inspect detached structures, other than garages and carports;
 13. inspect common elements or areas in multi-unit housing, such as condominium properties or cooperative housing;
 14. dismantle any system or component, except as specifically required by these standards of practice; or
 15. perform air or water intrusion tests or other tests upon roofs, windows, doors or other components of the structure to determine its resistance to air or water penetration.
- C. Home inspectors shall not:
1. offer or perform any act or service contrary to law;
 2. report on the market value of the property or its marketability;
 3. report on the advisability or inadvisability of purchase of the property;
 4. report on any component or system that was not inspected;

5. report on the presence or absence of pests such as wood damaging organisms, rodents or insects; however the home inspector may advise the client of damages to the building and recommend further inspection by a licensed wood destroying insect inspector;

6. advertise or solicit to perform repair services on any system or component of the home which the inspector noted as deficient, significantly deficient or unsafe in his home inspection report from the time of the inspection until the date of the act of sale on the home inspected.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475 and R.S. 37:1478.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2746 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1690 (August 2004), LR 36:2862 (December 2010), LR 38:2532 (October 2012), LR 41:922 (May 2015).

§311. Structural Systems

A. The home inspector shall inspect structural components including:

1. foundation;
2. framing;
3. columns; and
4. piers.

B. The home inspector shall describe the type of:

1. foundation;
2. floor structure;
3. wall structure;
4. columns;
5. piers;
6. ceiling structure; and
7. roof structure.

C. The home inspector shall:

1. probe structural components only where deterioration is visible, except where probing would damage any surface;
2. enter readily accessible under floor crawl spaces, basements, and attic spaces and, if applicable, report the reason why an area was not readily accessible;
3. report the methods used to inspect or access under floor crawl spaces and attics; and
4. report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2747 (December 2000), amended by the Office of the Governor, Board

Title 46, Part XL

of Home Inspectors, LR 30:1690 (August 2004), LR 41:923 (May 2015).

§313. Exterior System

- A. The home inspector shall inspect:
1. wall cladding, flashings and trim;
 2. all doors, including garage doors and storm doors;
 3. all readily accessible windows;
 4. decks, balconies, stoops, steps, porches, and applicable railings;
 5. eaves, soffits, and fascias where visible from the ground level; and
 6. vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building.
- B. The home inspector shall:
1. describe wall cladding materials;
 2. operate all entryway doors;
 3. operate garage doors and test the electronic safety beam reverse feature by interrupting the electronic beam (if present); and
 4. report whether or not the garage door operator is equipped with a pressure sensitive safety reverse feature and whether that feature was tested.
- C. The home inspector is not required to inspect:
1. shutters, awnings, and similar seasonal accessories;
 2. fences;
 3. presence of safety glazing in doors and windows;
 4. garage door operator remote control transmitters;
 5. geological conditions;
 6. soil conditions;
 7. recreational facilities;
 8. detached buildings or structures other than garages and carports;
 9. the presence or condition of buried fuel storage tanks;
 10. sea walls, break walls or docks;
 11. erosion control and earth stabilization measures; or
 12. garage door operator pressure sensitive reverse failure devices.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2747 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1691 (August 2004), LR 36:2862 (December 2010), LR 38:2532 (October 2012), LR 41:923 (May 2015).

§315. Roofing System

- A. The home inspector shall inspect:
1. roof coverings;
 2. roof drainage components;
 3. flashings;
 4. skylights, chimneys, and roof penetrations; and
 5. signs of leaks or abnormal condensation on building components.
- B. The home inspector shall:
1. describe the type of roof covering materials; and
 2. report the methods used to inspect the roofing system and any limitations.
- C. The home inspector is not required to:
1. walk on the roofing;
 2. inspect interiors of flues or chimneys which are not readily accessible;
 3. inspect attached accessories including but not limited to solar systems, antennae, and lightning arrestors; or
 4. disturb or lift roofing materials, jacks or flashing.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home inspectors, LR 26:2747 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1691 (August 2004), LR 36:2862 (December 2010), LR 38:2532 (October 2012), LR 41:923 (May 2015).

§317. Plumbing System

- A. The home inspector shall inspect:
1. water supply and distribution systems, including:
 - a. piping materials, supports, insulation;
 - b. fixtures and faucets;
 - c. functional flow;
 - d. visible leaks; and
 - e. cross connections;
 2. interior drain, waste and vent system, including: traps, drain, waste, and vent piping; piping supports and pipe insulation; leaks, and functional drainage;
 3. hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues and vents;
 4. fuel storage and distribution systems including interior fuel storage equipment, supply piping, venting, and supports; leaks; and
 5. sump pumps, drainage sumps, and related piping.

PROFESSIONAL AND OCCUPATIONAL STANDARDS

B. The home inspector shall describe:

1. water supply and distribution piping materials;
2. drain, waste and vent piping materials;
3. water heating equipment;
4. location of main water supply shutoff device; and
5. the location of main gas supply shutoff device.

C. The home inspector shall operate all plumbing and plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance or winterized equipment.

D. The home inspector is not required to:

1. determine the effectiveness of anti-siphon devices;
2. determine whether water supply and waste disposal systems are public or private;
3. operate automatic safety controls;
4. operate any valve except water closet flush valves, fixture faucets, and hose faucets;
5. determine whether the system is properly sized or utilizes proper materials;
6. inspect:
 - a. water conditioning systems;
 - b. fire and lawn sprinkler systems;
 - c. on-site water supply quantity and quality;
 - d. on-site waste disposal systems;
 - e. foundation irrigation systems;
 - f. spas;
 - g. swimming pools;
 - h. solar water heating equipment; or
 - i. wells, well pumps, or water storage related equipment.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home inspectors, LR 26:2747 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1691 (August 2004), LR 41:923 (May 2015).

§319. Electrical System

A. The home inspector shall inspect:

1. service drop and entrance conductors cables and raceways;
2. service equipment, main disconnect device, main and sub-panels, interior panel components, and service grounding;

3. branch circuit conductors, their overcurrent devices, and their compatibility;

4. the operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles;

5. the polarity and grounding of all receptacles tested; and

6. test ground fault circuit interrupters and arc fault circuit interrupters, unless, in the opinion of the inspector, such testing is likely to cause damage to any installed items or components of the home or interrupt service to an electrical device or equipment located in or around the home.

B. The home inspector shall describe:

1. service amperage and voltage;
2. wiring methods employed; and
3. the location of main and distribution panels.

C. The home inspector shall report any observed solid conductor aluminum branch circuit wiring for 120 volt circuits.

D. The home inspector shall report on the presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system.

E. The home inspector is not required to:

1. insert any tool, probe, or testing device inside the panels;
2. test or operate any overcurrent device except ground fault circuit interrupters and arc fault circuit interrupters in accordance with §319.A.6;
3. dismantle any electrical device or control other than to remove the dead front covers of the main and auxiliary distribution panels; or
4. inspect:
 - a. low voltage systems;
 - b. security system devices, heat detectors, carbon monoxide detectors or smoke detectors that are not part of a central system;
 - c. telephone, security, cable TV, intercoms, or other ancillary wiring that is not part of the primary electrical distribution system; or
 - d. remote controlled device unless the device is the only control device; or
 5. measure amperage, voltage or impedance.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home inspectors, LR 26:2748 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1691 (August 2004), LR 36:2863

Title 46, Part XL

(December 2010), LR 38:2533 (October 2012), LR 41:923 (May 2015).

§321. Air Conditioning and Heating System

A. The home inspector shall inspect permanently installed heating and cooling systems including:

1. heating, cooling and air handling equipment installed through the wall;
2. normal operating controls;
3. chimneys, flues, and vents, where readily accessible;
4. solid fuel heating devices, including fireplaces;
5. air distribution systems including fans, pumps, ducts and piping, with associated supports, insulation, air filters, registers, radiators, fan coil units, convectors; and
6. the presence of an installed heat and/or cooling source in each habitable room.

B. The home inspector shall describe:

1. energy sources; and
2. the heating and cooling methods by their distinguishing characteristics.

C. The home inspector shall operate the systems using normal operating controls.

D. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance.

E. The home inspector is not required to:

1. operate heating systems when weather conditions or other circumstances may cause equipment damage;
2. operate automatic safety controls;
3. inspect or operate air duct dampers; or
4. inspect:
 - a. heat exchangers;
 - b. humidifiers;
 - c. dehumidifiers;
 - d. electronic air filters;
 - e. the uniformity, adequacy or balance of heat or cooling supply to habitable rooms;
 - f. solar space heating systems;
 - g. components of solid fuel heating devices, such as firescreens and doors, seals and gaskets, automatic fuel feed devices, mantles and fireplace surrounds, combustion make-up air devices, heat distribution assists, whether gravity controlled or fan assisted; or
 - h. ignite or extinguish fires, determine draft characteristics, or move fireplace inserts, stoves or fireboxes.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2748 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1692 (August 2004), LR 36:2863 (December 2010), repromulgated LR 38:2533 (October 2012), amended LR 41:923 (May 2015).

§325. Interior System

A. The home inspector shall inspect:

1. walls, ceiling, and floors;
2. steps, stairways, balconies, and railings;
3. countertops and a representative number of cabinets and drawers;
4. all doors; and
5. all readily accessible windows.

B. The home inspector shall:

1. operate a representative number of windows and interior doors;
2. report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components;
3. report the presence of suspected mold or microbial growth if, during the course of inspecting the systems and components of the structure in accordance with the home inspector licensing law and these rules, the licensed home inspector discovers visually observable evidence of suspected mold or microbial growth.

C. The home inspector is not required to inspect:

1. paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors;
2. carpeting;
3. draperies, blinds, or other window treatments; or
4. interior recreational facilities.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2749 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1692 (August 2004), LR 37:2406 (August 2011), LR 38:2533 (October 2012), LR 41:923 (May 2015).

§327. Insulation and Ventilation System

A. The home inspector shall inspect:

1. insulation and vapor retarders in unfinished spaces;
2. ventilation of attics and foundation areas;
3. kitchen, bathroom, and laundry venting system; and
4. the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control.

PROFESSIONAL AND OCCUPATIONAL STANDARDS

- B. The home inspector shall describe:
1. insulation and vapor retarders in unfinished spaces; and
 2. absence of insulation in unfinished space at conditioned surfaces.
- C. The home inspector is not required to report on:
1. concealed insulation and vapor retarders; or
 2. venting equipment that is integral with household appliances.
- D. The home inspector is not required to:
1. disturb insulation or vapor retarders; or
 2. determine indoor air quality.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2749 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1692 (August 2004).

§329. Built-In Kitchen Appliances

A. The home inspector shall inspect and operate the basic functions of the following appliances:

1. permanently installed dishwasher; through its normal cycle;
2. range, cook top, and permanently installed oven;
3. trash compactor;
4. garbage disposal;
5. ventilation equipment or range hood;
6. permanently installed microwave oven; and
7. any other built-in appliance.

B. The home inspector is not required to inspect:

1. clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation;
2. non built-in appliances such as clothes washers and dryers;
3. refrigeration units such as freezers, refrigerators and ice makers; or
4. central vacuum system.

C. The home inspector is not required to operate:

1. appliances in use; or
2. any appliance that is shut down or otherwise inoperable.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2749 (December 2000), amended by the Office of the Governor, Board

of Home Inspectors, LR 30:1692 (August 2004), LR 41:923 (May 2015).

Chapter 5. Code of Ethics**§501. Code of Ethics**

A. Purpose. Integrity, honesty, and objectivity are fundamental principles embraced by this Code of Ethics, which sets forth the obligations of ethical conduct for the Licensed Home Inspector (LHI). The Louisiana State Board of Home Inspectors (LSBHI) has enacted this Code to provide high ethical standards to safeguard the public and the profession. LHIs in Louisiana shall comply with this Code, shall avoid association with any enterprise whose practices violate this Code, and shall strive to uphold, maintain, and improve the integrity, reputation, and practice of the home inspection profession.

B. Ethical Obligations

1. The LHI shall avoid conflicts of interest or activities that compromise, or appear to compromise, professional independence, objectivity, or inspection integrity.

2. The LHI shall not inspect properties for compensation in which he has or expects to have, a financial interest.

3. The LHI shall not inspect properties under contingent arrangements whereby any compensation or future referrals are dependent upon reported or non-reported findings or on the sale of a property.

4. The LHI shall not directly or indirectly compensate real estate agents, brokers, or any other parties having a financial interest in the closing/settlement of real estate transactions, for the referral of inspections or for inclusion on a list of recommended inspectors, preferred providers, or similar arrangements.

5. The LHI shall not receive compensation from more than one party per inspection unless agreed to by the client(s).

6. The LHI shall not accept compensation, directly or indirectly, for referring or recommending contractors or other service providers or products to inspection clients or other parties having an interest in inspected properties, unless disclosed and scheduled prior to the home inspection.

7. The LHI shall not advertise or solicit to repair, replace or upgrade for compensation, any system or component of the home which the inspector noted as significantly deficient or unsafe in his home inspection report, or any other type of service on the home upon which he has performed a home inspection, from the time of the inspection until the date of the act of sale on the home inspected.

8. The LHI shall act in good faith toward each client and other interested parties.

Title 46, Part XL

9. The LHI shall perform services and express opinions based upon genuine conviction and only within his areas of education, training or experience.

10. The LHI shall be objective in his reporting and shall not knowingly understate or overstate the significance of observed conditions.

11. The LHI shall not disclose inspection results or a client's personal information without approval of the client or the clients designated representative. At his discretion, the LHI may immediately disclose to occupants or interested parties safety hazards observed to which they may be exposed.

12. The LHI shall avoid activities that may harm the public, discredit him or reduce public confidence in the profession.

13. The LHI shall not disseminate or distribute advertising, marketing, or promotional materials which are fraudulent, false, deceptive, or misleading with respect to the education, experience, or qualifications of the LHI or the company with which he is affiliated.

14. The LHI shall include his license number on all advertising, marketing and promotional material.

15. The LHI shall report substantial and willful violations of this Code to the LSBHI.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2749 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1693 (August 2004), LR 36:2863 (December 2010), LR 37:2406 (August 2011), LR 41:924 (May 2015).

Chapter 7. Disciplinary Actions

§701. Definitions

A. The following definitions are used in this Chapter. The definitions in the law and these rules are incorporated into Chapter 1, Chapter 3, and Chapter 5 by reference.

File or Filing—to place the document or item to be filed into the care and custody of the board. The board shall note thereon the filing date. All documents filed with the board, except exhibits, shall be filed in duplicate on letter size 8" by 11" paper.

Party—the board, the licensee, and/or any other person who has an administratively cognizable interest in a particular board proceeding.

Service—personal delivery or, unless otherwise provided by law or rule, delivery by certified mail through the United States Postal Service, return receipt requested, addressed to the person to be served at his or her last known address. A Certificate of Service shall be appended to every document requiring service under these rules.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475 and R.S. 37:1485-1487.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2750 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1693 (August 2004), LR 41:924 (May 2015).

§703. Complaints

A. Anyone with knowledge that a licensee or member of the public is or has been engaged in any conduct proscribed by the law or these rules, may file a written complaint with the board against that person.

B. An information memorandum approved by the board containing instructions for filing a complaint shall be mailed to anyone requesting such information from the board and shall be made available on the board's official website.

C. The complaint shall specifically identify the licensee or member of the public and describe the misconduct.

D. The complaint shall refer to specific violations of these rules or of the Home Inspector Licensing Law. If the complaint involves violations of the standards of practice that the licensee did not observe or report, a list of those items must be submitted with the complaint along with the corresponding violation of the standards of practice. A copy of any documentation supporting the allegations shall be filed with the complaint, if available, including but not limited to, photographs, the pre-inspection agreement, the inspection report, and any reports made by any other consultant.

E. The complaint shall be in writing, signed by the complainant, and dated. The complaint shall include the complainant's mailing address, a daytime phone number at which the complainant may be reached, and the street address of the structure made the basis of the complaint, if applicable.

F. The board shall not consider complaints against those performing services that are under the jurisdiction of other regulatory agencies or licensing boards, such as, wood destroying insect inspections, appraisals, or services rendered by licensed architects, engineers, or general contractors, unless the persons rendering those services are licensed home inspectors or hold themselves out as, or engage in the business of, a home inspector.

G. Based upon a review of the records of the board kept in the ordinary course of business, the Chief Operating Officer of the board may initiate a complaint against a licensee based upon the licensee's delinquency or failure to make timely payment of fees, fines or assessments or upon the licensee's failure to comply with reporting requirements, continuing education requirements, insurance requirements, or other requirements of the licensee. In all such cases, the Chief Operating Officer shall send the licensee notification by certified mail specifically outlining the delinquency or violation, including any amounts due. The licensee shall either, pay any fees due, comply with any requirements stated or respond, in writing, within 14 days receipt of the notice disputing the claim or amounts due. A licensee's failure to respond within the delays shall be prima facie

PROFESSIONAL AND OCCUPATIONAL STANDARDS

proof of his noncompliance subjecting the licensee to immediate suspension.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475, R.S. 37:1483, and R.S. 37:1485-1487.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2750 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1693 (August 2004), LR 40:1004 (May 2014).

§705. Special Investigating Entity

A. For all complaints filed pursuant to §703.A, the board shall appoint a committee, board member, employee, or other qualified licensee to verify whether the allegations listed in the complaint may indicate violations of these rules, the standards of practice, *Code of Ethics* or the law. This committee, board member, employee or licensee shall be referred to as the "special investigating entity." The chairman may appoint a special investigating entity at any time to commence review of a complaint. This appointment shall be ratified by the board in executive session at its next meeting.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2750 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1694 (August 2004), LR 40:1004 (May 2014), LR 41:924 (May 2015).

§707. Investigations; Special Investigating Entity; Board Review

A. Upon receipt of a complaint filed pursuant to §703.A and conforming with this Chapter, the board shall assign a docket number to the complaint and refer it to an SIE. Any individual or member of a committee appointed to serve as an SIE shall:

1. have been a Louisiana licensed home inspector for at least three years prior to the appointment;
2. be current on all continuing education, fees and other requirements for licensure;
3. have no pending complaints against him; and
4. have performed over 300 home inspections pursuant to this Chapter.

B. A copy of the complaint shall be served upon the home inspector or member of the public (respondent) in accordance with §707.D. The respondent shall submit a written response to the special investigating entity within two weeks after receipt of the copy of the complaint.

C. The SIE shall make an investigation of the charges and responses, with the sole purpose of determining whether or not the allegations listed in the complaint indicate a violation of these Rules or the Home Inspector Licensing Law. The SIE shall not visit or inspect the property at issue during the investigative process, but may contact the parties involved, and any third parties, to request any further information or documentation needed to conduct the

investigation. The SIE may review photographs, reports, correspondence and other documentation submitted by any party or third party in conducting the investigation. The SIE shall prepare a report of its findings within 30 days of the completion of the investigation, and file the report with the board.

D. A copy of the report of the SIE shall be mailed by the COO to the complainant and to the respondent by certified mail. The report shall contain:

1. the docket number;
2. the names of the parties involved;
3. a list of the documents reviewed in connection with the investigation; and
4. a list of the persons contacted in connection with the investigation and the manner in which that contact was made (e.g. telephone, email, mail, etc..).

E. The report shall state whether each specific allegation of the complaint has or lacks sufficient evidence to meet the threshold for a hearing before the board.

F. If the report states that any or all allegations of the complaint lack sufficient evidence to indicate a violation of these rules or the licensing law, the chief operating officer shall advise the complainant and respondent in writing that the evidence was insufficient to support a particular or all allegations in the complaint. The chief operating officer shall also advise the complainant and respondent that, in order for the lacking allegations of the complaint to be reviewed by the board, the complainant must make a written request for review by the board within 15 days of mailing of the report, must support the complaint with additional documentation and must set forth specific reasons why the SIE's determination on each allegation is incorrect.

G. If the complainant makes a written request for review by the board, the board shall review the report and the complainant's documentation. If the board finds that the allegations are unsupported by the evidence, the chief operating officer shall advise the complainant in writing that the board has concurred with the special investigating entity's conclusion that the complaint lacks sufficient evidence to support the allegations in the complaint.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475 and R.S. 37:1485.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2750 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1694 (August 2004), LR 36:2863 (December 2010), LR 40:1004 (May 2014).

§709. Disciplinary Hearing; Procedure

A. If the special investigating entity's report or the board's review finds that there is sufficient evidence to support the allegations in the complaint, the board shall fix a time and place for a disciplinary hearing and give notice to the licensee and complainant. The disciplinary hearing shall be held in accordance with the adjudication provisions of the Administrative Procedure Act.

Title 46, Part XL

B. The notice required under §709.A shall:

1. include a statement of the time, place, and nature of the hearing;
2. include a statement of the legal authority under which the hearing is to be held;
3. include reference to the particular sections of the statutes and rules involved;
4. include a short and plain statement of the matters asserted; and
5. be sent by certified mail.

C. In all contested case hearings before the board, the chairman of the board shall serve as presiding officer. In the absence of the chairman, the vice chairman shall serve as presiding officer, or a presiding officer shall be selected by the board.

D. No board member, committee member or employee serving as part of the special investigating entity shall participate in the consideration or decision of the matter or confection of the board's decision, order or opinion. However, any member of the special investigating entity may prosecute the case against the licensee or respondent.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475 and R.S. 37:1485.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2751 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1695 (August 2004), LR 36:2863 (December 2010).

§711. Pre-Hearing Resolution

A. The board's staff and the licensee or other person against whom a complaint has been brought may attempt to resolve the complaint by means of a consensual agreement. Such consensual agreement may impose upon the respondent penalties or conditions which include, but are not limited to, requiring the licensee to complete additional training or educational courses, placing the inspector on probation, issuing a letter of reprimand, imposing fines of up to \$1,000 per separate violation, and/or suspending or revoking the inspectors license, all as authorized in the law or these rules.

B. The proposed consent agreement shall then be presented to the board at its next meeting. The board may accept the consent agreement as written, modify the agreement and send it back to the licensee for acceptance, or reject the consent agreement. Accepted agreements shall be filed in the record of the docket.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475 and R.S. 37:1485-1487.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2751 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1694 (August 2004), LR 41:924 (May 2015).

§713. Hearing Procedure; Decision; Notice; Effective Date; Rehearing

A. If no consent agreement is reached, the matter shall be heard by the board at its next regularly scheduled board meeting or special meeting which is to be held not less than 10 days prior to giving notice to all interested parties. The board shall consider the law and the evidence presented or in the record and base its decision accordingly.

B. No attorney, board member or employee serving as the prosecuting officer for the board shall participate in the consideration or formulation of the board's decision, any opinion related thereto, or any procedural matter.

C. The board shall render any final decision or order by majority vote of the board in open session. The date of the decision or order shall be indicated on the decision or order.

D. All parties of record shall receive notice of the board's decision within 30 days of the vote on the matter.

E. A board decision or order may be reconsidered by the board at the next board meeting on its own motion, or on motion by a party of record, for good cause shown pursuant to a written request filed at the board's office within 10 days following the decision date.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1475 and R.S. 37:1485-1487.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home inspectors, LR 26:2751 (December 2000), amended by the Office of the Governor, Board of Home Inspectors, LR 30:1695 (August 2004), LR 38:2533 (October 2012), LR 41:924 (May 2015).

Chapter 9. Declaratory Orders

§901. Purpose

A. The purpose of this Chapter is to settle and afford relief from any uncertainty and insecurity with respect to the rules of the board or the law.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1471-1489.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2751 (December 2000).

§903. Declaratory Relief

A. The board may declare rights, status, and other legal relations of any interested person whose rights may be affected by the rules of the board or by the law. Any person whose rights, status, or other legal relations are affected by these rules may have determined any question of construction or validity arising under these rules or the law and obtain a declaration of rights, status or other legal relations thereunder from the board.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1471-1489.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2751 (December 2000).

PROFESSIONAL AND OCCUPATIONAL STANDARDS

§905. Applications; Petitions; Parties

A. An application for declaratory order shall be made on a form provided by the board. The application for declaratory order must include the name, address and telephone number, both business and home, of the person bringing the application for declaratory order, the specific rule or rules at issue, and the specific question directed to the board. The application for declaratory order shall also advise the board of the name, address and telephone numbers of all persons who have or may claim any interest which may be affected by any decision or determination of the board. The board shall docket the application for declaratory order. The board shall provide notice of the application, along with a copy of the application for declaratory order to the person(s) identified who have or may claim an interest affected by any decision or determination of the board. Those persons who have or claim an interest shall confirm same in writing to the board within 15 days from the date of the board's notice containing the application for declaratory order.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1471-1489.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2751 (December 2000).

§907. Governing Law

A. When an action is initiated under this Chapter, all proceedings shall be in accordance with the rules of the board, the Administrative Procedure Act, and other applicable Louisiana law.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1471-1489.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2752 (December 2000).

§909. Hearings; Decisions; Rehearing; Time

A. All hearings on applications for declaratory orders filed at least 10 days prior to a scheduled board meeting shall be set for hearing at that meeting unless the board desires the matter be set prior thereto, in which case the parties will be notified of the earlier hearing date, time and place.

B. The board shall render its decision in open session and transmit written confirmation to parties of record within 30 days of its decision.

C. The board may decline to address the question presented and dismiss the application for declaratory order.

D. Board decisions may be reconsidered by the board at the next board meeting on its own motion or on the motion of a party of record for good cause shown pursuant to a written request filed at the board office within 10 days following the decision date.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1471-1489.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2752 (December 2000).

Chapter 11. Judicial Review**§1101. Judicial Review; Venue; Time**

A. Any party of record aggrieved by a final board order or decision in an adjudication, rulemaking or declaratory order shall be entitled to judicial review whether or not application has been made to the board for rehearing. Such judicial review shall be initiated by the filing of a petition setting forth the objections to the board's decision or order with the Nineteenth Judicial District Court within 30 days of the date of mailing of the final board order or decision as provided for in the Administrative Procedure Act.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1471-1489 and R.S. 49:964-966.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2752 (December 2000).

§1103. Appeals

A. Any party of record may obtain a review of final judgment of the Nineteenth Judicial District Court by the First Circuit Court of Appeal as provided for in the Administrative Procedure Act.

AUTHORITY NOTE: Promulgated in accordance with R.S. 37:1471-1489 and R.S. 49:964-966.

HISTORICAL NOTE: Promulgated by the Department of Economic Development, Board of Home Inspectors, LR 26:2752 (December 2000).